


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 52457	Main Street: ORCHARD_LAKE_DR	Cross Street: LUCY_JANE_LN	Location: NW
ADA ID: 2B61613319B3	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 2.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

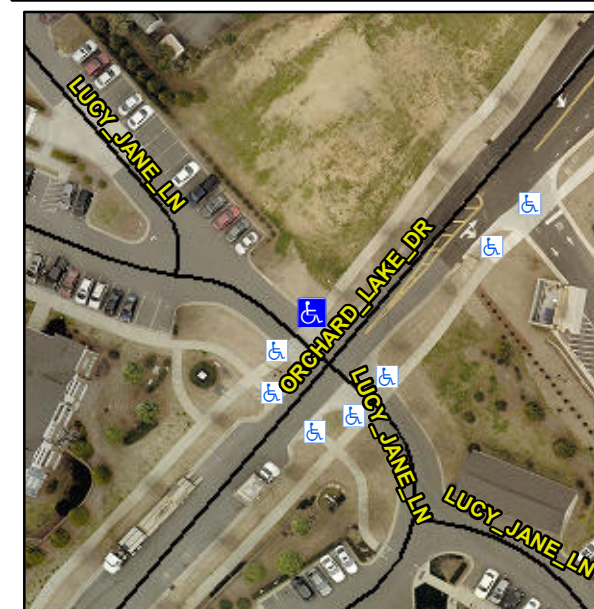

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R304.5.3, R304.5.2, R305.1.4, R305.2

Total Cost: \$ 1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	142.0	No	Grade Break?	No
Yes	Ramp Width (in)	71.5	N/A	Grade Break Slope (%)	0.8
Yes	Ramp Slope (%)	5.3	N/A	Grade Break XSlope (%)	0.3
Yes	Ramp XSlope (%)	1.1			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	78.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	3.3	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	7.0
N/A	Shared Landing?	No	No	DWS Offset RT (in)	4.5
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.0
N/A	Painted X Walk1?	No		Road Slope (%)	1.6
	X Walk 1 Direction	To SW		Road X Slope (%)	0.4
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	1.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.4	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	8.7

