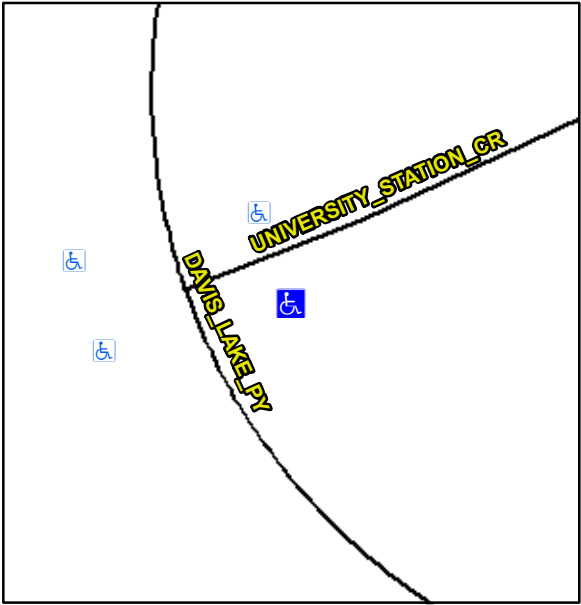


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 4219	Main Street: DAVIS_LAKE_PY	Cross Street: UNIVERSITY_STATION_CR	Location: SE
ADA ID: 2B8EBACCD99C	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 33.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:		Compliance		Description		Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A		Ramp Length (in)		29.0	N/A	Grade Break?	N/A
			No		Ramp Width (in)		44.0	N/A	Grade Break Slope (%)	0.0
			No		Ramp Slope (%)		11.3	N/A	Grade Break XSlope (%)	0.0
			No		Ramp XSlope (%)		6.1			
			N/A		Flare Type LT		N/A	N/A	Flare Type RT	N/A
			N/A		Flare Slope LT (%)		N/A	N/A	Flare Slope RT (%)	0.0
			N/A		Flare Traversable LT?		N/A	N/A	Flare Traversable RT?	N/A
			N/A		Landing Length (in)		0.0	N/A	DWS Provided?	N/A
			N/A		Landing Width (in)		0.0	N/A	DWS Contrast?	N/A
			N/A		Landing Slope (%)		0.0	N/A	DWS Length (in)	N/A
			N/A		Landing X Slope (%)		0.0	N/A	DWS Full Width?	N/A
			N/A		Landing Curb? (Y/N)		N/A	N/A	DWS Offset LT (in)	N/A
			N/A		Shared Landing?		N/A	N/A	DWS Offset RT (in)	N/A
			N/A		Gutter Ponding?		0.0	N/A	Gutter Slope (%)	N/A
			N/A		Gutter Lip Ht (in)		0.0	N/A	Gutter X Slope (%)	N/A
			N/A		Painted X Walk1?		No		Road Slope (%)	1.3
					X Walk 1 Direction	To NW			Road X Slope (%)	8.4
					X Walk 1 Width (in)		N/A		Clear Space?	N/A
					X Walk 1 Slope (%)		1.3	N/A	Clear Space to XWalk (in)	N/A
					X Walk 1 X Slope (%)		8.4	N/A	Storm Grate/Utility Hazard?	N/A
			N/A		Ramp inside XWalk1?		N/A		Storm Grate/Utility Type	
			N/A		Any Obstructions?		N/A			N/A
					Obstruction Type			Yes	Surface Condition? (G/P)	Good
								N/A	Curb Slope (%)	N/A
Surveyor Notes:										
N/A										
PROW/ADA:										
R304.5.1, R304.2.2, R304.5.3										
Total Cost:		\$	1600.00							

