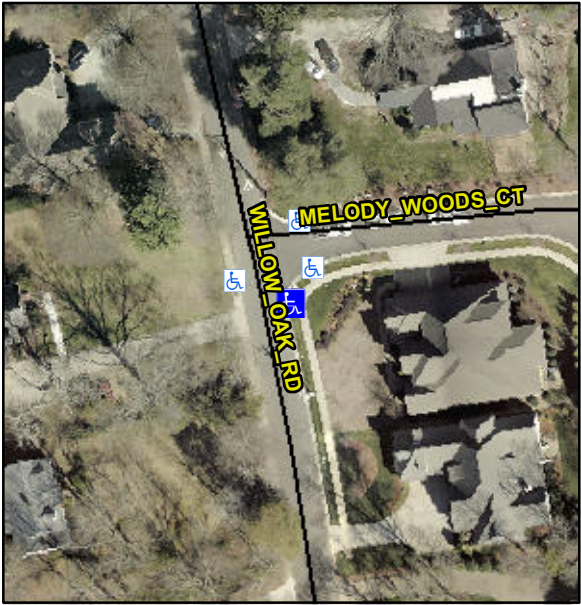


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53044	Main Street: MELODY_WOODS_CT	Cross Street: WILLOW_OAK_RD	Location: SE
ADA ID: 2BBECD80FABF	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 20.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		Yes	Ramp Length (in)	57.0
	Remove & Replace Gutter.		No	Ramp Width (in)	48.0
			N/A	Flare Type LT	Sloped
			N/A	Flare Slope LT (%)	1.6
			N/A	Flare Traversable LT?	Yes
			Yes	Landing Length (in)	48.5
			Yes	Landing Width (in)	48.0
			Yes	Landing Slope (%)	0.4
			Yes	Landing X Slope (%)	1.8
Surveyor Notes: N/A PROW/ADA: Not Found, R304.5.3, R305.2, R302.7.2, R304.5.4			N/A	Flare Type RT	N/A
			Yes	Flare Slope RT (%)	3.7
			N/A	Flare Traversable RT?	Yes
			Yes	DWS Provided?	Yes
			Yes	DWS Contrast?	Yes
			Yes	DWS Length (in)	24.0
			Yes	DWS Full Width?	Yes
			No	DWS Offset (in)	6.0
			No	Gutter Ponding?	No
			No	Gutter Lip Ht (in)	1.0
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To W
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	6.5
				X Walk 1 X Slope (%)	0.2
			N/A	Ramp inside XWalk1?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			Yes	Any Obstructions?	No
				Obstruction Type	
Total Cost: \$ 2600.00			N/A	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

