


Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 17742 Main Street: S_WENDOVER_RD Cross Street: PROVIDENCE_RD Location: SE

ADA ID: 2C27C06FE687 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 22.5

Codes/Mitigation Info/Possible Solution **Field Measurements/Component Compliance**

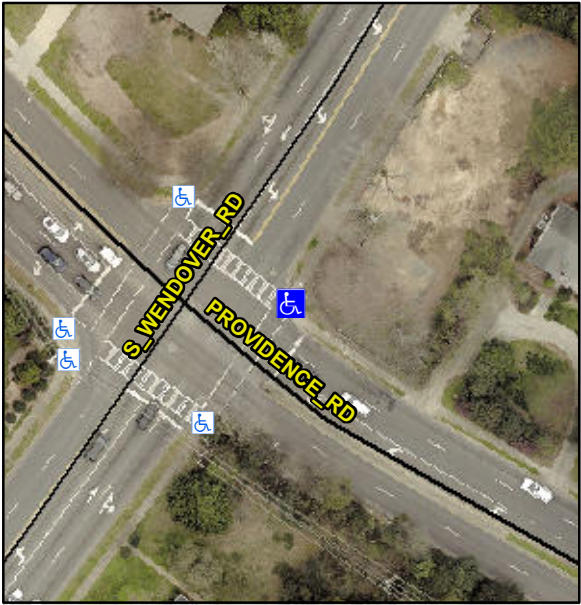

Possible Solutions:
Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:
N/A

PROW/ADA:
Not Found, R304.5.1, R304.2.2, R304.5.3

Street 1 Name **S WENDOVER RD**
Stop Condition-Street 2 **Signal**
Street 2 Name **PROVIDENCE RD**
Stop Condition-Street 1 **Signal**

Total Cost: \$ **3200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	50.0	No	Ramp Slope (%)	11.8
No	Ramp Width (in)	36.5	No	Ramp XSlope (%)	3.0
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	105.5	N/A	X Walk 2 Width (in)	102.5
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	5.6
	X Walk 1 X Slope (%)	4.8		X Walk 2 X Slope (%)	1.9
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	Yes
	Road Slope (%)	1.4	N/A	Clear Space?	N/A
	Road X Slope (%)	8.7	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

