

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 48555	Main Street: COTTON_PRESS_RD	Cross Street: RIDGEFOREST_DR	Location: E
ADA ID: 2C376C8167A3	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 7.5	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

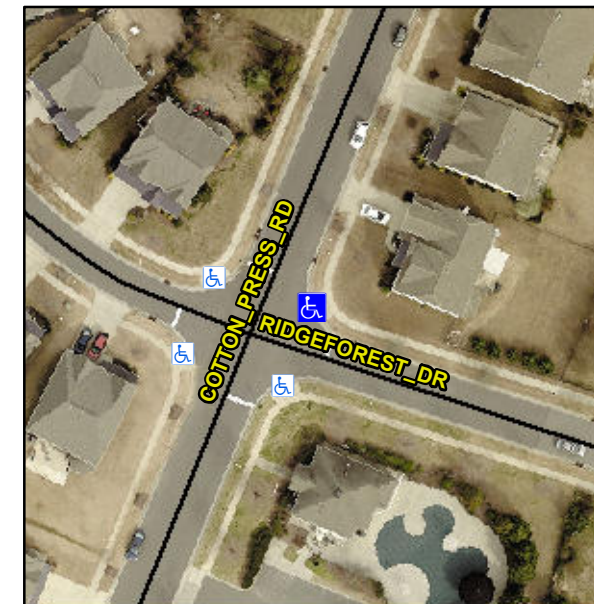

Possible Solutions:

**Grind Gutter Lip.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R302.7.2**

Total Cost:

**\$ 200.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.0	Yes	Ramp Slope (%)	6.3
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	5.2	Yes	Flare Slope RT (%)	5.3
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	48.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.5	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.9
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.2
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NW		X Walk 2 Direction	To SW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.4		X Walk 2 Slope (%)	0.7
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	1.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.5	N/A	Clear Space?	Yes
	Road X Slope (%)	1.5	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **COTTON PRESS RD**

Stop Condition-Street 2 **None**

Street 2 Name **RIDGEFOREST DR**

Stop Condition-Street 1 **StopSign**

