


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 17393	Main Street: LOCHRIDGE_RD	Cross Street: MURRAYHILL_RD	Location:	W
ADA ID: 2C9E7C2871C2	Ramp Type: Combination1Diag	Initial Pass/Fail: Pass	Overall Compliance: No	Severity Score: 0

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

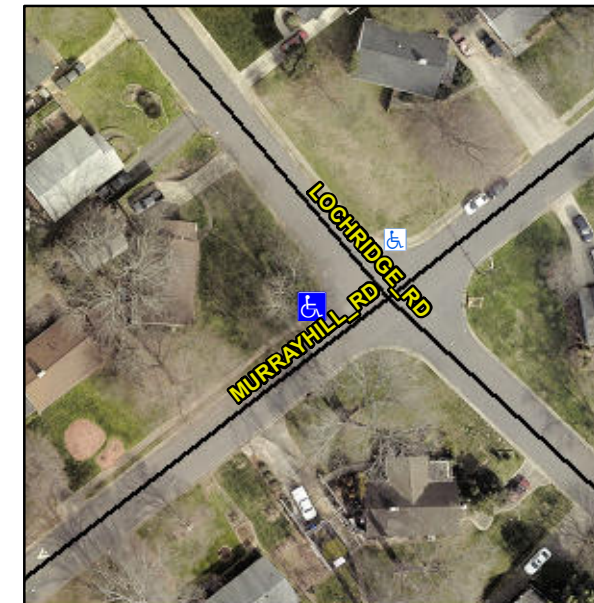

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2-Perp, R304.3.2-Para, R302.7

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	19.0	N/A	Ramp Length RT (in)	24.0
Yes	Ramp Width LT (in)	50.0	Yes	Ramp Width RT (in)	50.0
Yes	Ramp Slope LT (%)	6.1	Yes	Ramp Slope RT (%)	5.5
Yes	Ramp XSlope LT (%)	1.1	Yes	Ramp XSlope RT (%)	0.7
N/A	Ramp Length (in)	24.5	Yes	Ramp Slope (%)	3.6
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	0.8
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
Yes	Flare Slope LT (%)	8.6	Yes	Flare Slope RT (%)	8.9
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	50.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.3	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	2.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.0
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SE		X Walk 2 Direction	To NE
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.7		X Walk 2 Slope (%)	1.0
	X Walk 1 X Slope (%)	0.6		X Walk 2 X Slope (%)	0.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.4		Clear Space?	Yes
	Road X Slope (%)	0.5	N/A	Clear Space to XWalk (in)	N/A
			Yes	Any Obstruction?	No
				Obstruction Type	N/A
			Yes	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	9.8

Street 1 Name None
 Stop Condition-Street 1 MURRAYHILL RD
 Street 2 Name StopSign
 Stop Condition-Street 2 LOCHRIDGE RD

