

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 52613	Main Street: GRAHAM RIDGE DR	Cross Street: HERITAGE POND DR	Location: N
ADA ID: 2CB02422D430	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

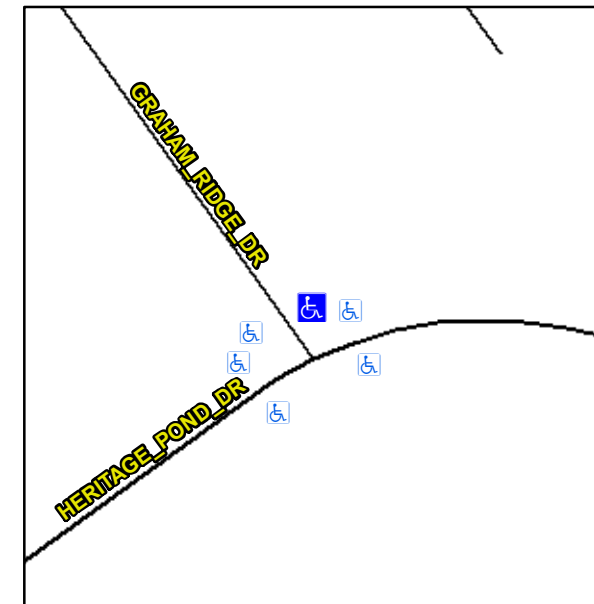

Possible Solutions:

**Remove & Replace Landing.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.2.2-Perp, R304.3.2-Para**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	103.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	75.5	Yes	Grade Break Slope (%)	4.6
Yes	Ramp Slope (%)	7.3	Yes	Grade Break XSlope (%)	1.1
Yes	Ramp XSlope (%)	1.2			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	69.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	72.5	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.8	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	32.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	1.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.9
N/A	Painted X Walk1?	Yes		Road Slope (%)	0.6
	X Walk 1 Direction	To SW		Road X Slope (%)	0.5
	X Walk 1 Width (in)	70.5		Clear Space?	Yes
	X Walk 1 Slope (%)	0.6	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.5	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Total Cost: \$ 500.00

Street 1 Name	GRAHAM RIDGE DR
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

