


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 10034966Main Street:PROVIDENCE_RD_WESTCross Street: N/ALocation:NWADA ID: 2D252403E056Ramp Type:Directional1Initial Pass/Fail: FailOverall Compliance: NoSeverity Score:12.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

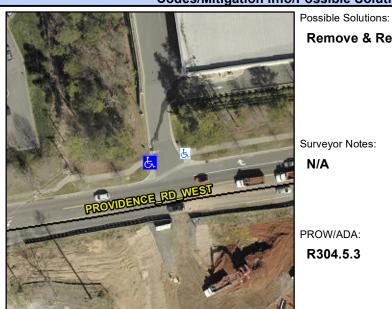

Street 1 Name	ENTRANCE
Stop Condition-Street 1	StopSign
Street 2 Name	N/A
Stop Condition-Street 2	N/A

1 ossible colutions.				
Remove & Replace Entire Ramp.				
Surveyor Notes:				
N/A				
PROW/ADA:				
R304.5.3				
100-11010				

			1	100
CKS QL TIM RO			*	
R. S.			STATE OF	
				_
1				
	10	-		

Total Cost:



1600.00

Comp	liance Description	Data	Comp	oliance Description	Data
N/A	Ramp Length (in)	109.0	N/A	Grade Break?	N/A
Yes	Ramp Width (in)	69.0	N/A	Grade Break Slope (%)	0.0
Yes	Ramp Slope (%)	1.2	N/A	Grade Break XSlope (%)	0.0
No	Ramp XSlope (%)	5.4			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No		Road Slope (%)	0.7
	X Walk 1 Direction	To NE		Road X Slope (%)	3.4
	X Walk 1 Width (in)	N/A	l	Clear Space?	N/A
	X Walk 1 Slope (%)	0.7	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	3.4	N/A	Storm Grate/Utility Hazard?	N/A
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
N/A	Any Obstructions?	N/A			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
		N/A	N/A	Curb Slope (%)	0.5

