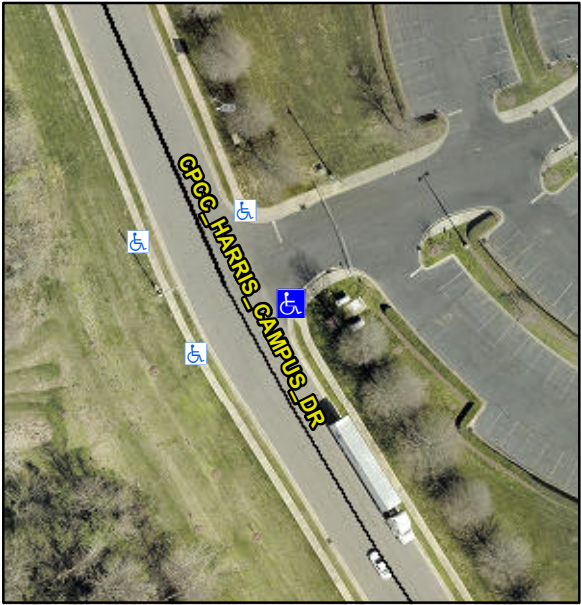


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10024247	Main Street: CPCC_HARRIS_CAMPUS_DR	Cross Street: N/A	Location: SE
ADA ID: 2D5453BC8A69	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>		<b>N/A</b>	Ramp Length LT (in)	<b>48.0</b>
			<b>Yes</b>	Ramp Width LT (in)	<b>58.0</b>
			<b>No</b>	Ramp Slope LT (%)	<b>10.3</b>
			<b>Yes</b>	Ramp XSlope LT (%)	<b>1.1</b>
			<b>N/A</b>	Landing Length (in)	<b>N/A</b>
			<b>N/A</b>	Landing Width (in)	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>
<p>Surveyor Notes:</p> <p><b>N/A</b></p> <p>PROW/ADA:</p> <p><b>R304.3.2, R304.5.3</b></p>			<b>N/A</b>	Ramp XSlope RT (%)	<b>4.1</b>
			<b>N/A</b>	DWS Provided?	<b>N/A</b>
			<b>N/A</b>	DWS Contrast?	<b>N/A</b>
			<b>N/A</b>	DWS Length (in)	<b>N/A</b>
			<b>N/A</b>	DWS Full Width?	<b>N/A</b>
			<b>N/A</b>	DWS Offset (in)	<b>N/A</b>
			<b>N/A</b>	Gutter Slope (%)	<b>N/A</b>
			<b>N/A</b>	Gutter X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Painted X Walk1?	<b>No</b>
			<b>N/A</b>	Painted X Walk2?	<b>No</b>
			<b>N/A</b>	X Walk 1 Direction	<b>To NW</b>
			<b>N/A</b>	X Walk 2 Direction	<b>To SW</b>
			<b>N/A</b>	X Walk 1 Width (in)	<b>N/A</b>
			<b>N/A</b>	X Walk 2 Width (in)	<b>N/A</b>
			<b>3.5</b>	X Walk 1 Slope (%)	<b>1.8</b>
			<b>1.5</b>	X Walk 2 Slope (%)	<b>5.0</b>
			<b>N/A</b>	X Walk 1 X Slope (%)	<b>N/A</b>
			<b>N/A</b>	X Walk 2 X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Ramp inside XWalk1?	<b>N/A</b>
			<b>N/A</b>	Ramp inside XWalk2?	<b>N/A</b>
			<b>3.4</b>	Road Slope (%)	<b>N/A</b>
			<b>3.4</b>	Clear Space?	<b>N/A</b>
			<b>N/A</b>	Clear Space to XWalk (in)	<b>N/A</b>
			<b>N/A</b>	Storm Grate/Utility Hazard?	<b>N/A</b>
			<b>N/A</b>	Storm Grate/Utility Type	<b>N/A</b>
			<b>N/A</b>	Any Obstructions?	<b>N/A</b>
			<b>N/A</b>	Obstruction Type	<b>N/A</b>
			<b>N/A</b>	Surface Condition? (G/P)	<b>Good</b>
			<b>N/A</b>	Curb Slope (%)	<b>8.6</b>

Total Cost: \$ 3200.00

