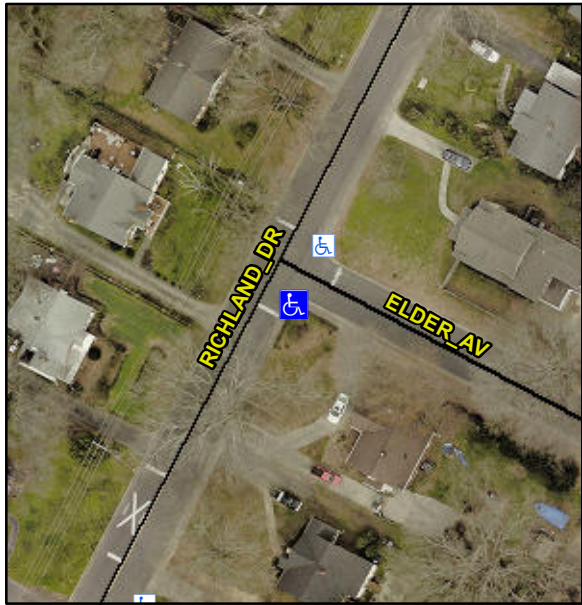


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 16290	Main Street: ELDER_AV	Cross Street: RICHLAND_DR	Location:	S
ADA ID: 2D5772B9800B	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 30

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		<b>Compliance</b>	<b>Description</b>	<b>Data</b>	<b>Compliance</b>	<b>Description</b>	<b>Data</b>
	<b>Remove &amp; Replace Entire Ramp.</b>		N/A	Ramp Length LT (in)	45.0	N/A	Ramp Length RT (in)	33.0
			Yes	Ramp Width LT (in)	48.0	Yes	Ramp Width RT (in)	48.0
			Yes	Ramp Slope LT (%)	0.4	Yes	Ramp Slope RT (%)	7.7
			Yes	Ramp XSlope LT (%)	0.9	Yes	Ramp XSlope RT (%)	1.7
			N/A	Ramp Length (in)	52.0	Yes	Ramp Slope (%)	2.8
			No	Ramp Width (in)	34.0	No	Ramp XSlope (%)	6.3
	Surveyor Notes:		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
	<b>LT RP &lt; 5%</b>		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
PROW/ADA:		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
<b>Not Found, R304.5.1, R304.5.3</b>		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
		N/A	Shared Landing?	N/A				
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A	
			X Walk 1 Direction	To NE		X Walk 2 Direction	N/A	
			X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	N/A	
			X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	N/A	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	N/A		Clear Space?	N/A	
			Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
					N/A	Any Obstruction?	N/A	
						Obstruction Type	N/A	
								N/A
					N/A	Storm Grate/Utility Hazard?	N/A	
						Storm Grate/Utility Type	N/A	
								N/A
			Yes	Surface Condition? (G/P)	Good			
				Curb Slope (%)	6.5			
Street 1 Name		StopSign						
Stop Condition-Street 1		ELDER AV						
Street 2 Name		N/A						
Stop Condition-Street 2		N/A						
Total Cost:		\$ 1800.00						
