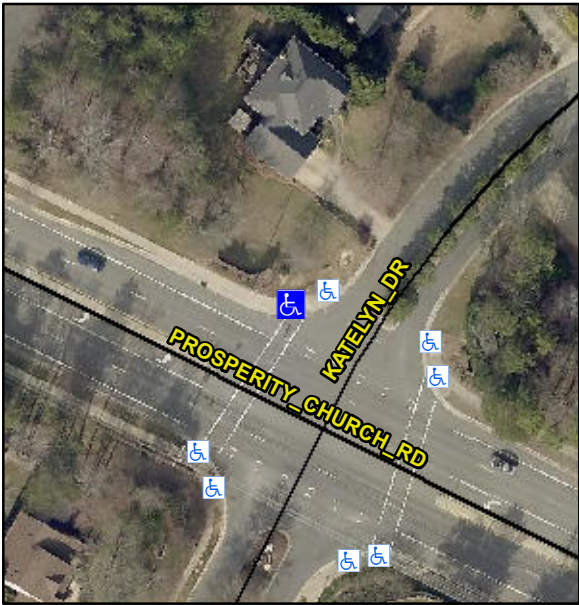


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 3373	Main Street: KATELYN_DR	Cross Street: PROSPERITY_CHURCH_RD	Location:	N
ADA ID: 2D5B8C0A504D	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 46.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance									
	Possible Solutions:		<b>Compliance</b>			<b>Description</b>			<b>Data</b>			
	<b>Remove &amp; Replace Entire Ramp.</b>		<b>N/A</b>	Ramp Length (in)		<b>72.0</b>	<b>No</b>	Ramp Slope (%)		<b>19.4</b>		
			<b>No</b>	Ramp Width (in)		<b>42.0</b>	<b>No</b>	Ramp XSlope (%)		<b>6.0</b>		
			<b>N/A</b>	Flare Type LT		<b>N/A</b>	<b>N/A</b>	Flare Type RT		<b>N/A</b>		
			<b>N/A</b>	Flare Slope LT (%)		<b>N/A</b>	<b>N/A</b>	Flare Slope RT (%)		<b>N/A</b>		
			<b>N/A</b>	Flare Traversable LT?		<b>N/A</b>	<b>N/A</b>	Flare Traversable RT?		<b>N/A</b>		
			<b>N/A</b>	Landing Length (in)		<b>N/A</b>	<b>N/A</b>	DWS Provided?		<b>N/A</b>		
			<b>N/A</b>	Landing Width (in)		<b>N/A</b>	<b>N/A</b>	DWS Contrast?		<b>N/A</b>		
			<b>N/A</b>	Landing Slope (%)		<b>N/A</b>	<b>N/A</b>	DWS Length (in)		<b>N/A</b>		
			<b>N/A</b>	Landing X Slope (%)		<b>N/A</b>	<b>N/A</b>	DWS Full Width?		<b>N/A</b>		
Surveyor Notes:		<b>N/A</b>			<b>N/A</b>	Landing Curb? (Y/N)		<b>N/A</b>	<b>N/A</b>	DWS Offset (in)		<b>N/A</b>
PROW/ADA:		<b>R304.5.1, R304.2.2, R304.5.3</b>			<b>N/A</b>	Shared Landing?		<b>N/A</b>				
					<b>N/A</b>	Gutter Ponding?		<b>N/A</b>	<b>N/A</b>	Gutter Slope (%)		<b>N/A</b>
					<b>N/A</b>	Gutter Lip Ht (in)		<b>N/A</b>	<b>N/A</b>	Gutter X Slope (%)		<b>N/A</b>
					<b>N/A</b>	Painted X Walk1?		<b>Yes</b>	<b>N/A</b>	Painted X Walk2?		<b>N/A</b>
						X Walk 1 Direction		<b>To SW</b>		X Walk 2 Direction		<b>N/A</b>
					<b>N/A</b>	X Walk 1 Width (in)		<b>93.0</b>	<b>N/A</b>	X Walk 2 Width (in)		<b>N/A</b>
						X Walk 1 Slope (%)		<b>5.5</b>		X Walk 2 Slope (%)		<b>N/A</b>
						X Walk 1 X Slope (%)		<b>1.3</b>		X Walk 2 X Slope (%)		<b>N/A</b>
					<b>N/A</b>	Ramp inside XWalk1?		<b>Yes</b>	<b>N/A</b>	Ramp inside XWalk2?		<b>N/A</b>
						Road Slope (%)		<b>N/A</b>	<b>N/A</b>	Clear Space?		<b>N/A</b>
						Road X Slope (%)		<b>N/A</b>	<b>N/A</b>	Clear Space to XWalk (in)		<b>N/A</b>
					<b>N/A</b>	Any Obstructions?		<b>N/A</b>	<b>N/A</b>	Storm Grate/Utility Hazard?		<b>N/A</b>
						Obstruction Type				Storm Grate/Utility Type		
								<b>N/A</b>				<b>N/A</b>
								<b>Yes</b>		Surface Condition? (G/P)		<b>Good</b>

