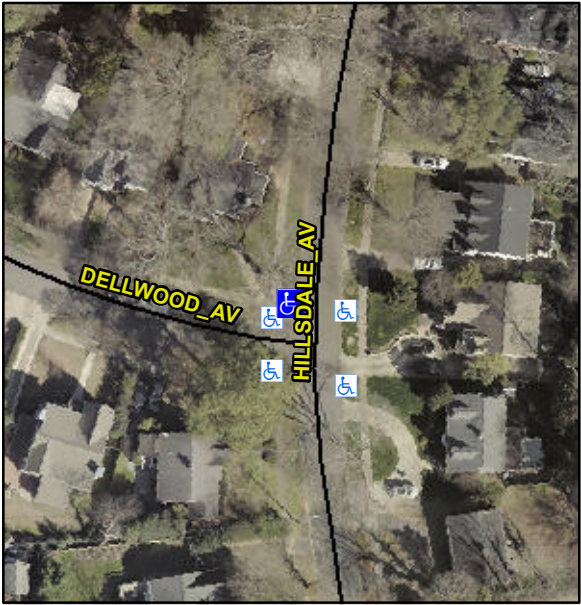


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 18083	Main Street: DELLWOOD_AV	Cross Street: HILLSDALE_AV	Location: NW
ADA ID: 2DBB2F7EDCE8	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 25	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance			
	Possible Solutions:		Compliance	Description	Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	45.0	Yes
			Yes	Ramp Width (in)	57.0	No
			N/A	Flare Type LT	N/A	N/A
			N/A	Flare Slope LT (%)	N/A	N/A
			N/A	Flare Traversable LT?	N/A	N/A
			N/A	Landing Length (in)	N/A	N/A
			N/A	Landing Width (in)	N/A	N/A
			N/A	Landing Slope (%)	N/A	N/A
			N/A	Landing X Slope (%)	N/A	N/A
			N/A	Landing Curb? (Y/N)	N/A	N/A
			N/A	Shared Landing?	N/A	
			N/A	Gutter Ponding?	N/A	N/A
			N/A	Gutter Lip Ht (in)	N/A	N/A
			N/A	Painted X Walk1?	No	N/A
				X Walk 1 Direction	To E	N/A
			N/A	X Walk 1 Width (in)	N/A	N/A
				X Walk 1 Slope (%)	7.0	N/A
				X Walk 1 X Slope (%)	6.1	N/A
			N/A	Ramp inside XWalk1?	N/A	N/A
Surveyor Notes: N/A PROW/ADA: R304.5.3			N/A	Road Slope (%)	N/A	N/A
			N/A	Road X Slope (%)	N/A	N/A
			N/A	Any Obstructions?	N/A	N/A
				Obstruction Type		
					N/A	N/A
			Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$ 1850.00				

