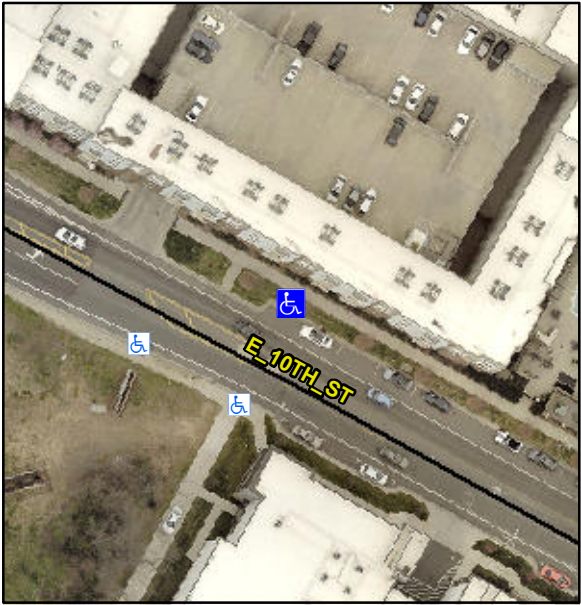


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 12669	Main Street: E_10TH_ST	Cross Street: STEVENS_ST	Location: NE
ADA ID: 2E62AC2E4F82	Ramp Type: Perp	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		No	Ramp Length (in)	95.0
			Yes	Ramp Width (in)	74.0
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	N/A
			N/A	Landing Width (in)	N/A
			N/A	Landing Slope (%)	N/A
			N/A	Landing X Slope (%)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.2.2</p>			N/A	Flare Type RT	N/A
			N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable RT?	N/A
			N/A	DWS Provided?	N/A
			N/A	DWS Contrast?	N/A
			N/A	DWS Length (in)	N/A
			N/A	DWS Full Width?	N/A
			N/A	DWS Offset (in)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	N/A
			N/A	Gutter Lip Ht (in)	N/A
			No	Painted X Walk1?	N/A
				X Walk 1 Direction	To S
			N/A	X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	2.6
				X Walk 1 X Slope (%)	7.7
			N/A	Ramp inside XWalk1?	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Road Slope (%)	N/A
			N/A	Road X Slope (%)	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
			N/A		
Total Cost:					
		\$ 1850.00			
			N/A		
			Yes	Surface Condition? (G/P)	Good

