


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 15870 Main Street: CHEROKEE_RD **Cross Street: HUNTLEY_PL** Location: NW **Overall Compliance: No** ADA ID: 2E6B4F33DCAE Ramp Type: Perp Initial Pass/Fail: Fail **Severity Score:** 12.5

Codes/Mitigation Info/Possible Solution

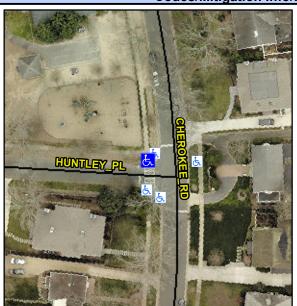

HUNTLEY PL Street 1 Name Stop Condition-Street 2 StopSign Street 2 Name N/A Stop Condition-Street 1 N/A

1 CCCIDIC CCIGNON	
Possible Solutions:	Comp
Remove & Replace Entire Ramp.	N/A
·	Yes
	N/A
	N/A
	N/A
	N/A
Surveyor Notes:	N/A
N/A	N/A
	N/A
	N/A
	N/A
PROW/ADA:	N/A
Not Found, R304.2.2	N/A
	N/A
	N/A
	N/A





Total Cost:



1850.00

Field Measurements/Component Compliance						
Compliance Description		Data	Comp	liance Description	Data	
N/A	Ramp Length (in)	77.0	No	Ramp Slope (%)	10.3	
Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.2	
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A	
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A	
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A	
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A	
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A	
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A	
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A	
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A	
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A	
N/A	X Walk 1 Width (in)	127.0	N/A	X Walk 2 Width (in)	N/A	
	X Walk 1 Slope (%)	0.7		X Walk 2 Slope (%)	N/A	
	X Walk 1 X Slope (%)	0.5		X Walk 2 X Slope (%)	N/A	
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A	
	Road Slope (%)	N/A	N/A	Clear Space?	N/A	
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A	
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
	Obstruction Type			Storm Grate/Utility Type		
		N/A			N/A	
			Yes	Surface Condition? (G/P)	Good	