

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 21102	Main Street: S_TRYON_ST	Cross Street: AYRSLEY_TOWN_BV	Location: E
ADA ID: 2E7C7117274F	Ramp Type: Combination1	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 37.5	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

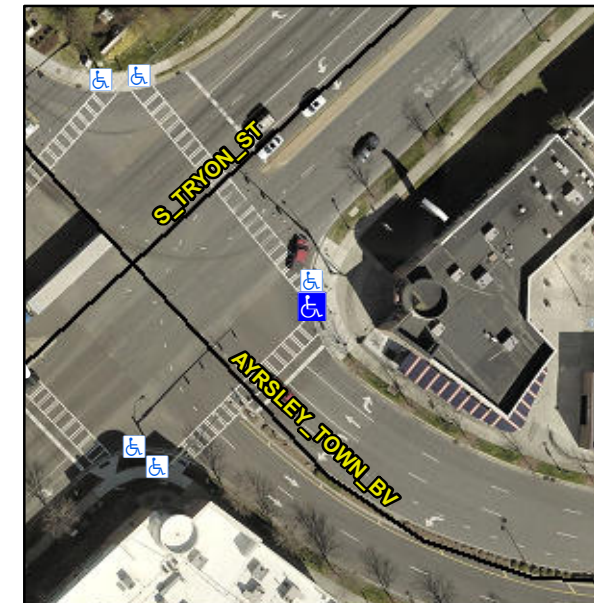

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

RT RP < 5%

PROW/ADA:

R304.2.2, R304.5.3, R304.3.2

Street 1 Name	Signal
Stop Condition-Street 1	AYRSLEY TOWN BV
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 1800.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	69.0	N/A	Ramp Length RT (in)	78.0
Yes	Ramp Width LT (in)	70.0	Yes	Ramp Width RT (in)	71.0
No	Ramp Slope LT (%)	12.2	Yes	Ramp Slope RT (%)	1.5
Yes	Ramp XSlope LT (%)	1.7	Yes	Ramp XSlope RT (%)	1.6
N/A	Ramp Length (in)	144.0	No	Ramp Slope (%)	9.5
Yes	Ramp Width (in)	65.0	No	Ramp XSlope (%)	5.8
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	111.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
					N/A
Yes	Surface Condition? (G/P)	Good			
	Curb Slope (%)	4.2			

