


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 10037286	Main Street: SARDIS_RD_NORTH	Cross Street: N/A	Location: N
ADA ID: 2E7CBC4E3D8E	Ramp Type: Para	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

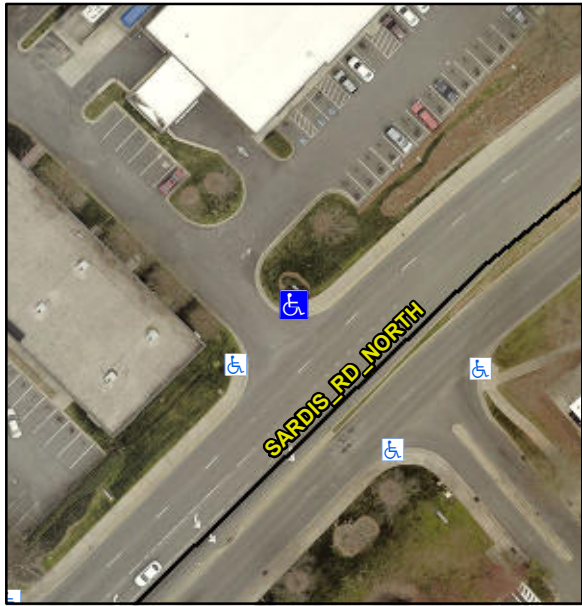

Street 1 NameENTRANCE

Stop Condition-Street 1StopSign

Street 2 NameN/A

Stop Condition-Street 2N/A

Possible Solutions:

Remove & Replace Entire Ramp.

Surveyor Notes:

LT RP < 5%

PROW/ADA:

R304.5.3, R304.3.2

Total Cost:

\$

1600.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	58.0	N/A	Ramp Length RT (in)	63.0
Yes	Ramp Width LT (in)	72.0	Yes	Ramp Width RT (in)	67.0
Yes	Ramp Slope LT (%)	3.1	No	Ramp Slope RT (%)	11.1
No	Ramp XSlope LT (%)	3.1	Yes	Ramp XSlope RT (%)	1.0
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.5		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.9		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	3.6