

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

|                        |                              |                                |                        |
|------------------------|------------------------------|--------------------------------|------------------------|
| Intersection ID: 45515 | Main Street: COTTON_PRESS_RD | Cross Street: HEDGEROW_PARK_RD | Location: NE           |
| ADA ID: 2F038664F5F1   | Ramp Type: Combination1Diag  | Initial Pass/Fail: Fail        | Overall Compliance: No |
|                        |                              | Severity Score: 0              |                        |

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

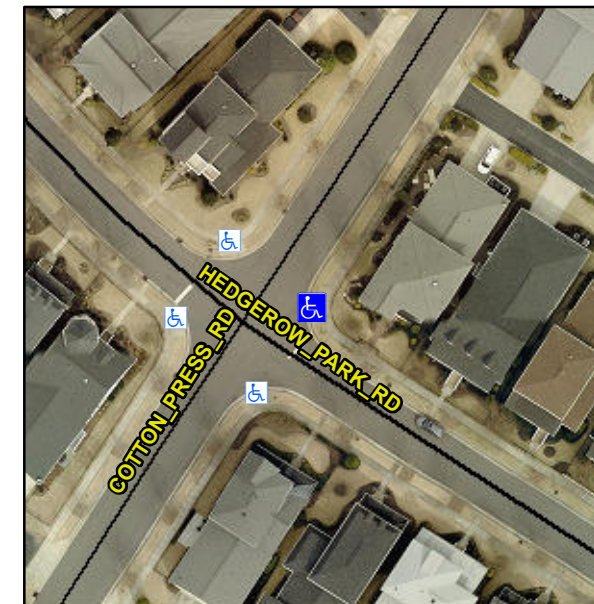

Possible Solutions:

**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.**

Surveyor Notes:

**RT RP < 5%**

PROW/ADA:

**R304.5.1, R304.2.2, R304.5.3**

Total Cost: \$ 3200.00

| Compliance | Description              | Data  | Compliance | Description                 | Data  |
|------------|--------------------------|-------|------------|-----------------------------|-------|
| N/A        | Ramp Length LT (in)      | 46.0  | N/A        | Ramp Length RT (in)         | 48.0  |
| Yes        | Ramp Width LT (in)       | 48.0  | Yes        | Ramp Width RT (in)          | 48.0  |
| Yes        | Ramp Slope LT (%)        | 5.6   | Yes        | Ramp Slope RT (%)           | 2.5   |
| No         | Ramp XSlope LT (%)       | 2.8   | Yes        | Ramp XSlope RT (%)          | 1.8   |
| N/A        | Ramp Length (in)         | 72.0  | No         | Ramp Slope (%)              | 10.5  |
| No         | Ramp Width (in)          | 33.0  | No         | Ramp XSlope (%)             | 4.2   |
| N/A        | Flare Type LT            | N/A   | N/A        | Flare Type RT               | N/A   |
| N/A        | Flare Slope LT (%)       | N/A   | N/A        | Flare Slope RT (%)          | N/A   |
| N/A        | Flare Traversable LT?    | N/A   | N/A        | Flare Traversable RT?       | N/A   |
| N/A        | Landing Length (in)      | N/A   | N/A        | DWS Provided?               | N/A   |
| N/A        | Landing Width (in)       | N/A   | N/A        | DWS Contrast?               | N/A   |
| N/A        | Landing Slope (%)        | N/A   | N/A        | DWS Length (in)             | N/A   |
| N/A        | Landing X Slope (%)      | N/A   | N/A        | DWS Full Width?             | N/A   |
| N/A        | Landing Curb? (Y/N)      | N/A   | N/A        | DWS Offset (in)             | N/A   |
| N/A        | Shared Landing?          | N/A   |            |                             |       |
| N/A        | Gutter Ponding?          | N/A   | N/A        | Gutter Slope (%)            | N/A   |
| N/A        | Gutter Lip Ht (in)       | N/A   | N/A        | Gutter X Slope (%)          | N/A   |
| N/A        | Painted X Walk1?         | No    | N/A        | Painted X Walk2?            | No    |
|            | X Walk 1 Direction       | To NW |            | X Walk 2 Direction          | To SW |
|            | X Walk 1 Width (in)      | N/A   |            | X Walk 2 Width (in)         | N/A   |
|            | X Walk 1 Slope (%)       | 3.6   |            | X Walk 2 Slope (%)          | 1.4   |
|            | X Walk 1 X Slope (%)     | 2.2   |            | X Walk 2 X Slope (%)        | 4.9   |
| N/A        | Ramp inside XWalk1?      | N/A   | N/A        | Ramp inside XWalk2?         | N/A   |
|            | Road Slope (%)           | 3.3   |            | Clear Space?                | N/A   |
|            | Road X Slope (%)         | 2.5   | N/A        | Clear Space to XWalk (in)   | N/A   |
|            |                          |       | N/A        | Any Obstruction?            | N/A   |
|            |                          |       |            | Obstruction Type            | N/A   |
|            |                          |       | N/A        | Storm Grate/Utility Hazard? | N/A   |
|            |                          |       |            | Storm Grate/Utility Type    | N/A   |
| Yes        | Surface Condition? (G/P) | Good  |            |                             |       |
|            | Curb Slope (%)           | 0.0   |            |                             |       |

Street 1 Name None

Stop Condition-Street 1 COTTON PRESS RD

Street 2 Name StopSign

Stop Condition-Street 2 HEDGEROW PARK RD

