



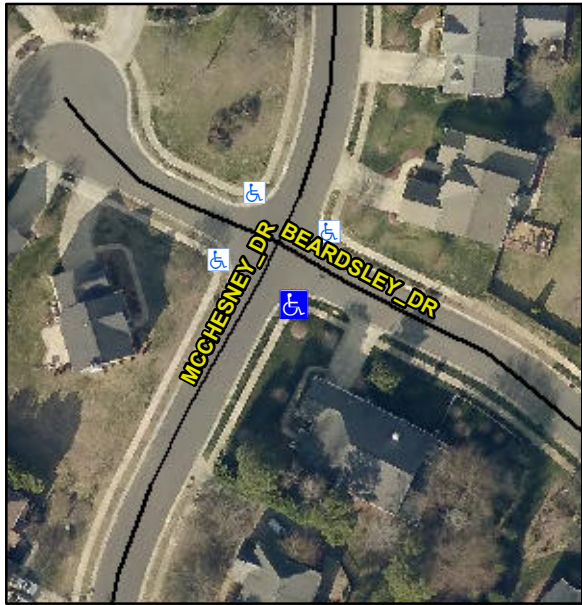
Access Compliance Report

Public Rights-of-Way

(Curb Ramps)



Intersection ID: 2549	Main Street: BEARDSLEY_DR	Cross Street: MCCHESENEY_DR	Location: S
ADA ID: 2F86D129ECA	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 12.5			

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		N/A	Ramp Length (in)	48.5	Yes	Ramp Slope (%)	5.3
			Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	6.2
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
	Surveyor Notes:		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
			N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
			N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
			N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A			Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A	
PROW/ADA:		N/A	Shared Landing?	N/A				
Not Found, R304.5.3		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A	
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A	
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No	
			X Walk 1 Direction	To NE		X Walk 2 Direction	To NW	
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A	
			X Walk 1 Slope (%)	0.2		X Walk 2 Slope (%)	5.5	
			X Walk 1 X Slope (%)	2.4		X Walk 2 X Slope (%)	1.5	
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A	
			Road Slope (%)	4.6	N/A	Clear Space?	N/A	
			Road X Slope (%)	2.7	N/A	Clear Space to XWalk (in)	N/A	
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A	
			Obstruction Type			Storm Grate/Utility Type		
				N/A			N/A	
					Yes	Surface Condition? (G/P)	Good	
Total Cost:		\$	3200.00					

Street 1 Name	BEARDSLEY DR
Stop Condition-Street 2	StopSign
Street 2 Name	MCCHESENEY DR
Stop Condition-Street 1	None

