


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14547	Main Street: EAST_BV	Cross Street: SPRINGDALE_AV	Location: W
ADA ID: 2FB4BD032B49	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 0.25			

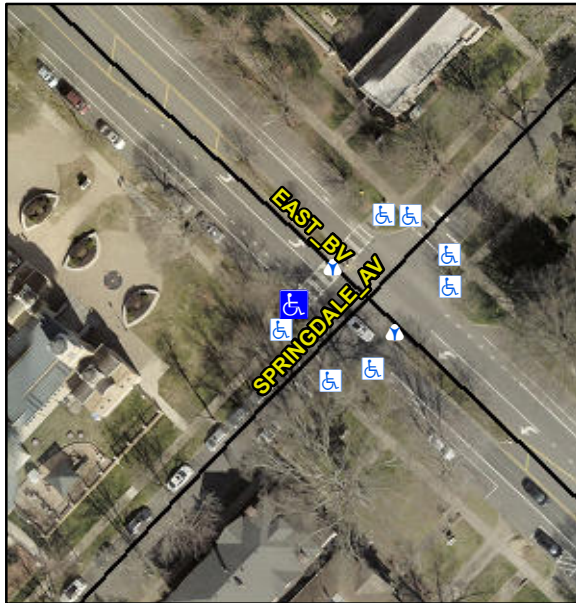

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

LNDG SLOPE NEGATIVE

PROW/ADA:

R304.5.3, R304.2.2-Perp, R304.3.2-Para

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	65.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	71.0	Yes	Grade Break Slope (%)	2.1
Yes	Ramp Slope (%)	3.6	Yes	Grade Break XSlope (%)	2.2
No	Ramp XSlope (%)	3.1			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	48.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	71.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	9.7	Yes	DWS Length (in)	25.0
Yes	Landing X Slope (%)	1.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset LT (in)	1.0
N/A	Shared Landing?	No	Yes	DWS Offset RT (in)	18.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.1
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.5
N/A	Painted X Walk1?	Yes		Road Slope (%)	2.2
	X Walk 1 Direction	To NE		Road X Slope (%)	2.2
	X Walk 1 Width (in)	112.0		Clear Space?	Yes
	X Walk 1 Slope (%)	2.2	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	2.2	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	7.3

