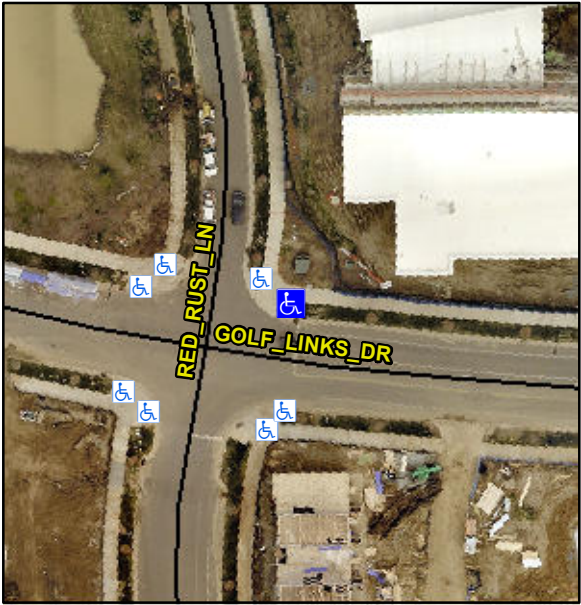


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48454	Main Street: RED_RUST_LN	Cross Street: GOLF_LINKS_DR	Location: NE
ADA ID: 2FF303FE9A29	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 5	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
	Possible Solutions:		Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	95.0
	Remove & Replace Gutter.		Yes	Ramp Width (in)	61.5
			N/A	Flare Type LT	Sloped
			N/A	Flare Slope LT (%)	6.0
			N/A	Flare Traversable LT?	Yes
			Yes	Landing Length (in)	95.0
			Yes	Landing Width (in)	61.5
			Yes	Landing Slope (%)	0.0
			Yes	Landing X Slope (%)	1.2
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>Not Found, R304.5.4, R304.5.3</p>			N/A	Flare Type RT	N/A
			Yes	Flare Slope RT (%)	7.0
			N/A	Flare Traversable RT?	Yes
			Yes	DWS Provided?	Yes
			Yes	DWS Contrast?	Yes
			Yes	DWS Length (in)	24.0
			Yes	DWS Full Width?	Yes
			N/A	DWS Offset (in)	1.5
			N/A	Shared Landing?	No
			Yes	Gutter Ponding?	No
<p>Total Cost:</p> <p>\$ 2600.00</p>			No	Gutter Slope (%)	7.0
			No	Gutter X Slope (%)	2.2
			N/A	Painted X Walk2?	N/A
				X Walk 2 Direction	N/A
			N/A	X Walk 2 Width (in)	N/A
				X Walk 2 Slope (%)	N/A
				X Walk 2 X Slope (%)	N/A
			N/A	Ramp inside XWalk2?	N/A
			N/A	Clear Space?	Yes
			N/A	Clear Space to XWalk (in)	N/A
<p>Yes</p> <p>Obstruction Type</p>			No	Storm Grate/Utility Hazard?	No
				Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

