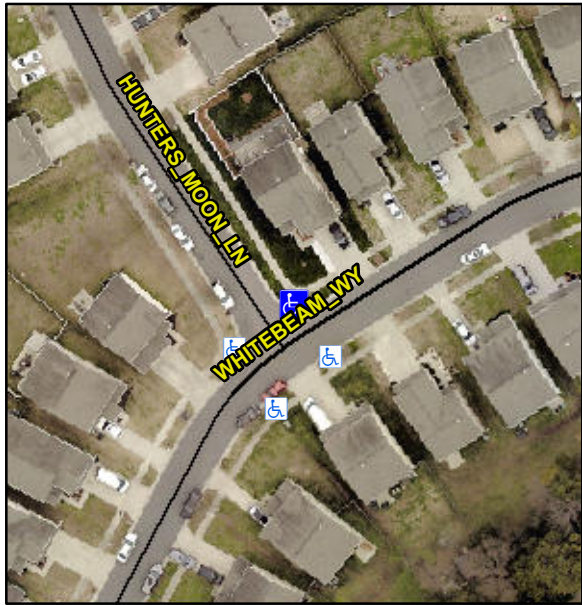


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 49321	Main Street: WHITEBEAM_WY	Cross Street: HUNTERS_MOON_LN	Location: NE
ADA ID: 3016068D1B67	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
 Street 1 Name HUNTERS MOON LN Stop Condition-Street 2 StopSign Street 2 Name WHITEBEAM WY Stop Condition-Street 1 None	Possible Solutions:		Compliance			Compliance		
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.		Description			Data		
	Surveyor Notes: N/A		N/A	Ramp Length (in)	70.0	Yes	Ramp Slope (%)	6.9
			Yes	Ramp Width (in)	48.0	Yes	Ramp XSlope (%)	1.1
			N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	6.2	Yes	Flare Slope RT (%)	1.8
			N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
			No	Landing Length (in)	40.0	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
			Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
			Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
			N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
			N/A	Shared Landing?	No			
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.6
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.7
			N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
				X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
			N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
				X Walk 1 Slope (%)	5.2		X Walk 2 Slope (%)	2.0
				X Walk 1 X Slope (%)	3.1		X Walk 2 X Slope (%)	5.9
			N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
		Road Slope (%)	0.4	N/A	Clear Space?	Yes		
		Road X Slope (%)	7.0	N/A	Clear Space to XWalk (in)	N/A		
	Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No		
		Obstruction Type			Storm Grate/Utility Type			
	Total Cost:		\$	3200.00	N/A			N/A
				Yes	Surface Condition? (G/P)	Good		

