


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: N/A	Main Street: S COLLEGE ST	Cross Street: HILL ST	Location: N
ADA ID: 3050DE0E4A74	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 0.25			

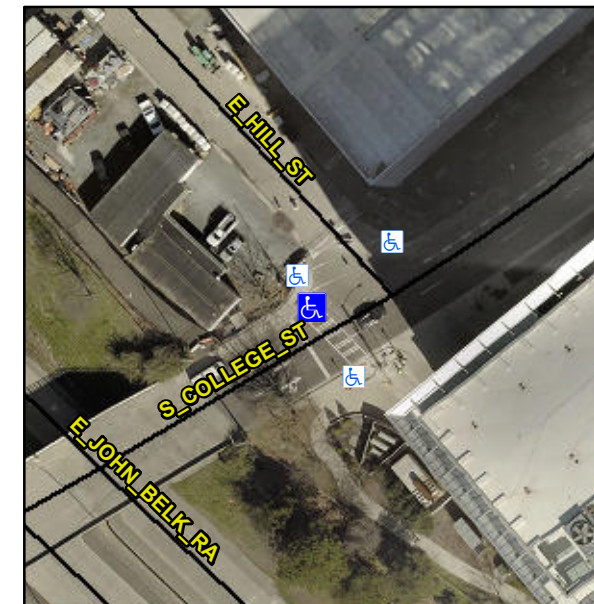

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.5.3, R304.2.2-Perp, R304.3.2-
Para**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	170.0	N/A	Ramp Length RT (in)	51.0
Yes	Ramp Width LT (in)	61.0	Yes	Ramp Width RT (in)	61.0
Yes	Ramp Slope LT (%)	7.8	Yes	Ramp Slope RT (%)	7.6
No	Ramp XSlope LT (%)	3.0	Yes	Ramp XSlope RT (%)	1.4
Yes	Landing Length (in)	61.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	59.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.9	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	4.8	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	Yes	Yes	DWS Offset (in)	0.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	3.8
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	5.4
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	104.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	5.3		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	2.9

