


Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 42401Main Street: GRIERS_GROVE_RDCross Street: MCALLISTER_DRLocation: WADA ID: 308BC5FEAB8FRamp Type: PerpInitial Pass/Fail: FailOverall Compliance: NoSeverity Score: 30

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

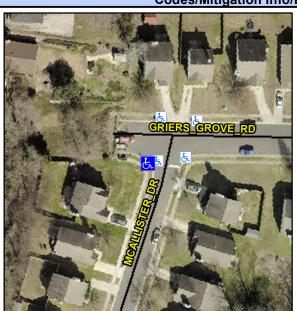

| Street 1 Name | MCALLISTER DR |
|-------------------------|---------------|
| Stop Condition-Street 2 | StopSign |
| Street 2 Name | N/A |
| Stop Condition-Street 1 | N/A |

| 1 0331bic Ocidiioii | |
|-------------------------------|----------|
| Possible Solutions: | <u>c</u> |
| Remove & Replace Entire Ramp. | N |
| | N |
| | N/ |
| | N |
| | N |
| | N |
| Surveyor Notes: | N |
| N/A | N |
| | N |
| | N |
| | N |
| PROW/ADA: | N |
| Not Found, R304.5.1, R304.2.2 | N/ |
| | N |
| | N |
| | N |
| | |

| DESTS FOR THE | | | | |
|---------------|--------------|----------|----|-------------|
| | | | | _ |
| | | | 孤善 | K. . |
| | Griers G ove | | 0 | |
| | | | | |
| | - 40 | <i>T</i> | | |
| | | | | |
| | | | - | |

Total Cost:



1850.00

| Comp | liance Description | Data | Comp | liance Description | Data |
|------|-----------------------|------|------|-----------------------------|------|
| N/A | Ramp Length (in) | 52.0 | No | Ramp Slope (%) | 8.4 |
| No | Ramp Width (in) | 34.0 | Yes | Ramp XSlope (%) | 1.9 |
| N/A | Flare Type LT | N/A | N/A | Flare Type RT | N/A |
| N/A | Flare Slope LT (%) | N/A | N/A | Flare Slope RT (%) | N/A |
| N/A | Flare Traversable LT? | N/A | N/A | Flare Traversable RT? | N/A |
| N/A | Landing Length (in) | N/A | N/A | DWS Provided? | N/A |
| N/A | Landing Width (in) | N/A | N/A | DWS Contrast? | N/A |
| N/A | Landing Slope (%) | N/A | N/A | DWS Length (in) | N/A |
| N/A | Landing X Slope (%) | N/A | N/A | DWS Full Width? | N/A |
| N/A | Landing Curb? (Y/N) | N/A | N/A | DWS Offset (in) | N/A |
| N/A | Shared Landing? | N/A | | | |
| N/A | Gutter Ponding? | N/A | N/A | Gutter Slope (%) | N/A |
| N/A | Gutter Lip Ht (in) | N/A | N/A | Gutter X Slope (%) | N/A |
| N/A | Painted X Walk1? | No | N/A | Painted X Walk2? | N/A |
| | X Walk 1 Direction | To E | | X Walk 2 Direction | N/A |
| N/A | X Walk 1 Width (in) | N/A | N/A | X Walk 2 Width (in) | N/A |
| | X Walk 1 Slope (%) | 3.7 | | X Walk 2 Slope (%) | N/A |
| | X Walk 1 X Slope (%) | 2.2 | | X Walk 2 X Slope (%) | N/A |
| N/A | Ramp inside XWalk1? | N/A | N/A | Ramp inside XWalk2? | N/A |
| | Road Slope (%) | N/A | N/A | Clear Space? | N/A |
| | Road X Slope (%) | N/A | N/A | Clear Space to XWalk (in) | N/A |
| N/A | Any Obstructions? | N/A | N/A | Storm Grate/Utility Hazard? | N/A |
| | Obstruction Type | | l | Storm Grate/Utility Type | |
| | | N/A | | | N/A |
| | | | Yes | Surface Condition? (G/P) | Good |
| | | | | | |

