


## Access Compliance Report Public Rights-of-Way (Curb Ramps)



Intersection ID: 31200 Main Street: OAKTON\_GLEN\_CT Cross Street: OAKTON\_HUNT\_DR Location: NE
ADA ID: 30F6CCCEB8C2 Ramp Type: PerpDiag Initial Pass/Fail: Fail Overall Compliance: No Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

## Field Measurements/Component Compliance

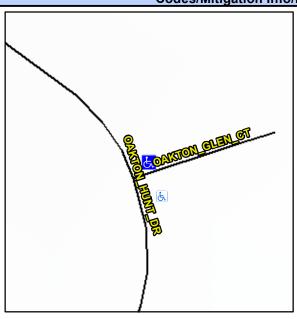

Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1 OAKTON HUNT DR None OAKTON GLEN CT StopSign Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Total Cost: \$ 3200.00

Field Measurements/Component Compliance					
Compliance Description		Data	Comp	liance Description	Data
N/A	Ramp Length (in)	48.0	No	Ramp Slope (%)	10.7
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	4.2
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To W		X Walk 2 Direction	To S
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	1.7		X Walk 2 Slope (%)	0.9
	X Walk 1 X Slope (%)	3.7		X Walk 2 X Slope (%)	2.2
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.0	N/A	Clear Space?	N/A
	Road X Slope (%)	1.9	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A

N/A

Storm Grate/Utility Type

Surface Condition? (G/P)

N/A

Good







**Obstruction Type**