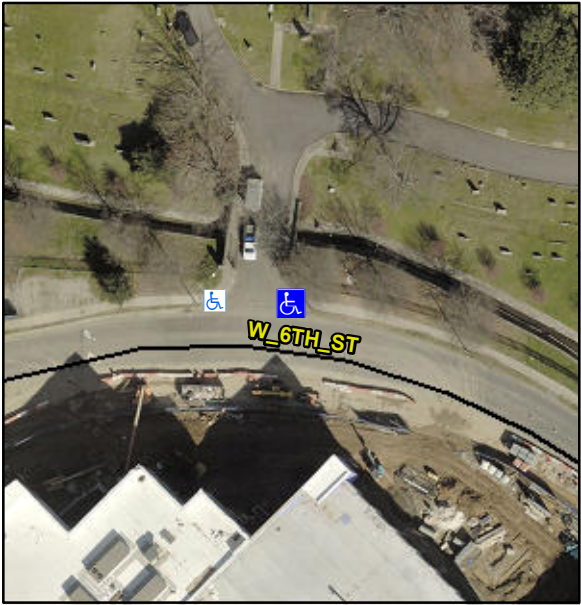


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10040544	Main Street: W_6TH_ST	Cross Street: N/A	Location: NE
ADA ID: 313052101B7F	Ramp Type: ParaDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 13.75			

	Possible Solutions:	Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.	N/A	Ramp Length LT (in)	63.0	N/A	Ramp Length RT (in)	60.0
		Yes	Ramp Width LT (in)	49.0	Yes	Ramp Width RT (in)	60.0
		Yes	Ramp Slope LT (%)	7.6	No	Ramp Slope RT (%)	9.0
		No	Ramp XSlope LT (%)	2.8	Yes	Ramp XSlope RT (%)	2.0
		N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
		N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.5.3, R304.3.2</p>		N/A	Shared Landing?	N/A			
		N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
			X Walk 1 Direction	To W		X Walk 2 Direction	To S
		N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
			X Walk 1 Slope (%)	7.7		X Walk 2 Slope (%)	5.7
			X Walk 1 X Slope (%)	0.0		X Walk 2 X Slope (%)	2.4
		N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
			Road Slope (%)	0.9	N/A	Clear Space?	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p> <p>ENTRANCE</p> <p>None</p> <p>W 6TH ST</p> <p>None</p>			Road X Slope (%)	5.7	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
			Obstruction Type			Storm Grate/Utility Type	
					N/A		N/A
					Yes	Surface Condition? (G/P)	Good
					N/A	Curb Slope (%)	9.1
Total Cost:		\$	3200.00				

