

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

62.0

54.0

5.4

3.0

5.3

0.2

N/A

Intersection ID: 53704 Main Street: MILLSTREAM RIDGE DR Cross Street: MILLSTREAM RIDGE DR W Location: **Severity Score:** 10 **ADA ID: 31FD2C263FE3** Ramp Type: Combination1 Initial Pass/Fail: Fail **Overall Compliance: No**

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

Yes

No

Yes

Yes

N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)

X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space?

Flare Traversable RT?

Ramp XSlope RT (%)

Data

75.0

48.0

3.0

1.3

48.0

41.0

N/A

Yes

To SE


72.0

3.7

3.0

Yes

N/A

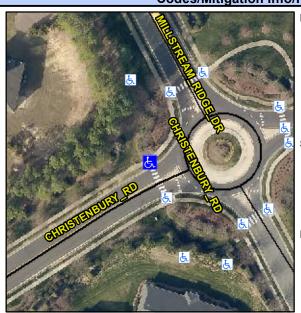

YieldSign Street 1 Name Stop Condition-Street 1 CHRISTENBURY RD N/A Street 2 Name Stop Condition-Street 2 N/A

Compliance Description Possible Solutions: N/A Remove & Replace Entire Ramp. Yes Yes Yes N/A No Surveyor Notes: N/A LT RP < 5% N/A PROW/ADA: R304.5.1, R304.5.3

Total Cost:

N/A Flare Traversable LT? N/A Landing Length (in) N/A Landing Width (in) N/A Landing Slope (%) N/A Landing X Slope (%) N/A Landing Curb? (Y/N) N/A Shared Landing? N/A **Gutter Ponding?** N/A Gutter Lip Ht (in) N/A Painted X Walk1? X Walk 1 Direction X Walk 1 Width (in) X Walk 1 Slope (%) X Walk 1 X Slope (%) N/A Ramp inside XWalk1? Road Slope (%)

Ramp Length LT (in)

Ramp Width LT (in)

Ramp Slope LT (%)

Ramp Length (in)

Ramp Width (in)

Flare Slope LT (%)

Flare Type LT

Ramp XSlope LT (%)



1800.00

N/A N/A Clear Space to XWalk (in) N/A N/A Any Obstruction? N/A **Obstruction Type** N/A N/A Storm Grate/Utility Hazard? N/A Storm Grate/Utility Type N/A Yes Surface Condition? (G/P) Good N/A Curb Slope (%)



