

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 7241	Main Street: ELGYWOOD_LN	Cross Street: TOM_HUNTER_RD	Location: SE
ADA ID: 322B3DDB2446	Ramp Type: Combination2	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 48.75	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

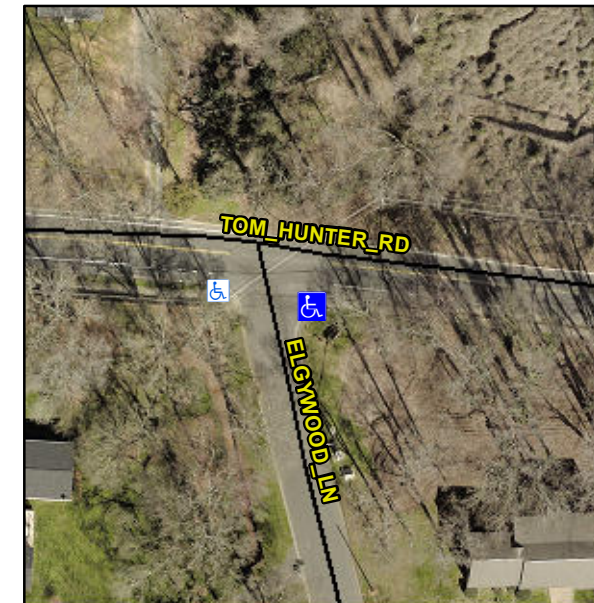

Possible Solutions:

**Remove & Replace Entire Ramp.**

Surveyor Notes:

**LT RP < 5%**

PROW/ADA:

**Not Found, R304.5.1, R304.5.3, R304.3.2**

Total Cost:

**\$ 1600.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	43.5	N/A	Ramp Length RT (in)	42.5
N/A	Ramp Width LT (in)	27.5	No	Ramp Width RT (in)	30.5
N/A	Ramp Slope LT (%)	2.4	No	Ramp Slope RT (%)	11.8
N/A	Ramp XSlope LT (%)	1.0	Yes	Ramp XSlope RT (%)	0.8
N/A	Ramp Length (in)	24.5	Yes	Ramp Slope (%)	6.6
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	3.9
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.9		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.5		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A		Clear Space?	N/A
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
			N/A	Any Obstruction?	N/A
				Obstruction Type	N/A
			N/A	Storm Grate/Utility Hazard?	N/A
				Storm Grate/Utility Type	N/A
			Yes	Surface Condition? (G/P)	Good
				Curb Slope (%)	19.7

