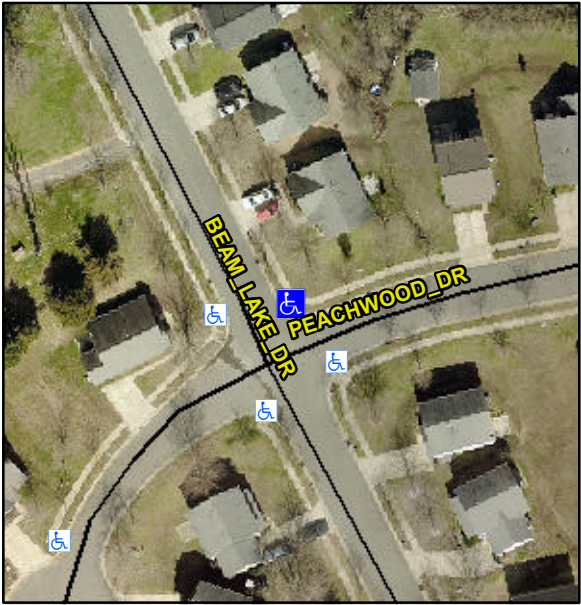


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 6218	Main Street: BEAM_LAKE_DR	Cross Street: PEACHWOOD_DR	Location: NE
ADA ID: 322B6510464E	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 31.25

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:				
	Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.				
	Surveyor Notes:				
	N/A				
	PROW/ADA:				
	Not Found, R304.5.1, R304.2.2, R304.5.3				
		Compliance	Description	Data	Compliance
		N/A	Ramp Length (in)	46.0	No
		No	Ramp Width (in)	32.0	No
		N/A	Flare Type LT	N/A	N/A
		N/A	Flare Slope LT (%)	N/A	N/A
		N/A	Flare Traversable LT?	N/A	N/A
		N/A	Landing Length (in)	N/A	N/A
		N/A	Landing Width (in)	N/A	N/A
		N/A	Landing Slope (%)	N/A	N/A
		N/A	Landing X Slope (%)	N/A	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A
		N/A	Shared Landing?	N/A	
		N/A	Gutter Ponding?	N/A	N/A
		N/A	Gutter Lip Ht (in)	N/A	N/A
		N/A	Painted X Walk1?	No	N/A
			X Walk 1 Direction	To NW	X Walk 2 Direction
		N/A	X Walk 1 Width (in)	N/A	N/A
			X Walk 1 Slope (%)	3.4	X Walk 2 Slope (%)
			X Walk 1 X Slope (%)	3.7	X Walk 2 X Slope (%)
		N/A	Ramp inside XWalk1?	N/A	N/A
			Road Slope (%)	2.9	N/A
			Road X Slope (%)	0.8	N/A
		N/A	Any Obstructions?	N/A	N/A
			Obstruction Type		
				N/A	N/A
				Yes	Surface Condition? (G/P)
					Good

Street 1 Name BEAM LAKE DR

Stop Condition-Street 2 None

Street 2 Name PEACHWOOD DR

Stop Condition-Street 1 StopSign

Total Cost: \$ 3200.00

