

Access Compliance Report Public Rights-of-Way (Curb Ramps)




Intersection ID: 13382 Main Street: E_CATHERINE_ST **Cross Street: S COLLEGE ST** Location:

ADA ID: 3254F2CB2A1B Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No** Severity Score: 26.25

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

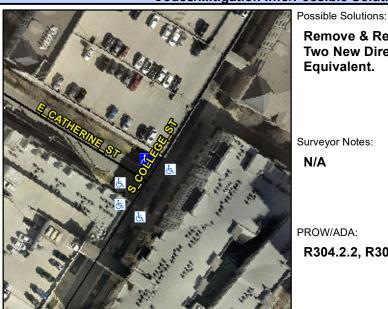

E CATHERINE ST Street 1 Name Stop Condition-Street 2 StopSign Street 2 Name S COLLEGE ST Stop Condition-Street 1 None

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

R304.2.2, R304.5.3

Total Cost:

Cor	npliance Description	Data	Com	pliance Description	Data
N/A	Ramp Length (in)	104.0	No	Ramp Slope (%)	13.5
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	2.2
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Direction	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.8		X Walk 2 Slope (%)	0.7
	X Walk 1 X Slope (%)	3.2		X Walk 2 X Slope (%)	1.3
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.2	N/A	Clear Space?	N/A
	Road X Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A

Yes

Surface Condition? (G/P)

Good







3200.00