


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 53016	Main Street: STEEL_HOUSE_BV	Cross Street: BESSEMER_ST	Location: SE
ADA ID: 32B1F19B86F6	Ramp Type: Perp	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 10			

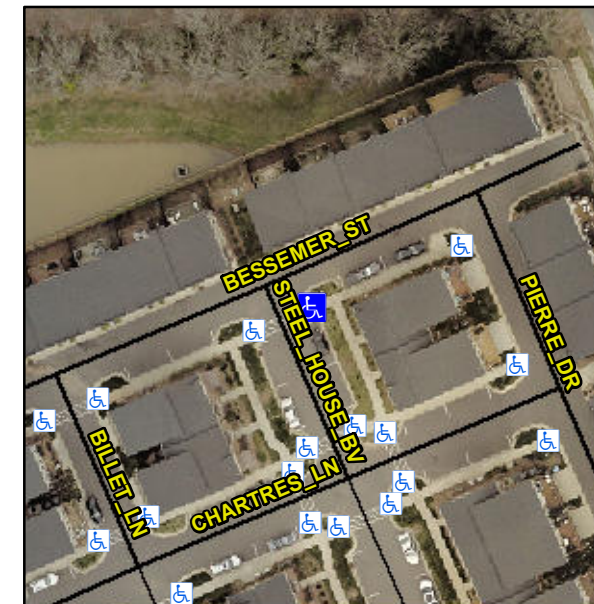

Possible Solutions:

**Remove & Replace Entire Ramp.  
Grind Gutter Lip.**

Surveyor Notes:

**N/A**

PROW/ADA:

**R304.5.3, R305.1.4, R305.2, R302.7.2**

Total Cost: \$ 2050.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	142.0	Yes	Ramp Slope (%)	6.0
Yes	Ramp Width (in)	60.0	Yes	Ramp XSlope (%)	1.3
N/A	Flare Type LT	None	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	60.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	60.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.8	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	4.6	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	12.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.9
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	2.0
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To SW		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	66.5	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
		Yes		Surface Condition? (G/P)	Good

Street 1 Name **STEEL HOUSE BV**  
 Stop Condition-Street 2 **StopSign**  
 Street 2 Name **N/A**  
 Stop Condition-Street 1 **N/A**

