

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Main Street: COLLINGHAM_DR Intersection ID: 54454 Cross Street: N/A Location: SE Ramp Type: Directional1 **Overall Compliance: No** ADA ID: 32E57316EDFA Initial Pass/Fail: Fail **Severity Score:** 12.5

Codes/Mitigation Info/Possible Solution




STEELE CREEK RD Street 1 Name None Stop Condition-Street 1 Street 2 Name N/A Stop Condition-Street 2 N/A

3	Possible Solutions:				
	Remove & Replace Entire Ramp.				
76	Surveyor Notes:				
The state of the s	N/A				
-	PROW/ADA:				
The State of	R304.2.2				

		N/A
		N/A
		N/A
		N/A
\$	1600.00	

Field Measurements/Component Compliance								
Compli	Data	Comp	liance Description	Data				
N/A	Ramp Length (in)	34.0	N/A	Grade Break?	N/A			
Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0			
No	Ramp Slope (%)	10.0	N/A	Grade Break XSlope (%)	0.0			
Yes	Ramp XSlope (%)	0.1						
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A			
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0			
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A			
N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A			
N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A			
N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A			
N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A			
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A			
N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A			
N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A			
N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A			
N/A	Painted X Walk1?	No		Road Slope (%)	4.8			
	X Walk 1 Direction	To NW		Road X Slope (%)	1.6			
	X Walk 1 Width (in)	N/A		Clear Space?	N/A			
	X Walk 1 Slope (%)	4.8	N/A	Clear Space to XWalk (in)	N/A			
	X Walk 1 X Slope (%)	1.6	N/A	Storm Grate/Utility Hazard?	N/A			
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type				
N/A	Any Obstructions?	N/A			N/A			
	Obstruction Type		Yes	Surface Condition? (G/P)	Good			
		N/A	N/A	Curb Slope (%)	14.1			



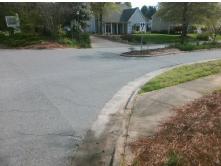

Total Cost:

