

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 48643	Main Street: SOCATA_WY	Cross Street: BROCK_RN	Location: SE
ADA ID: 343413CE0856	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 6.25	

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

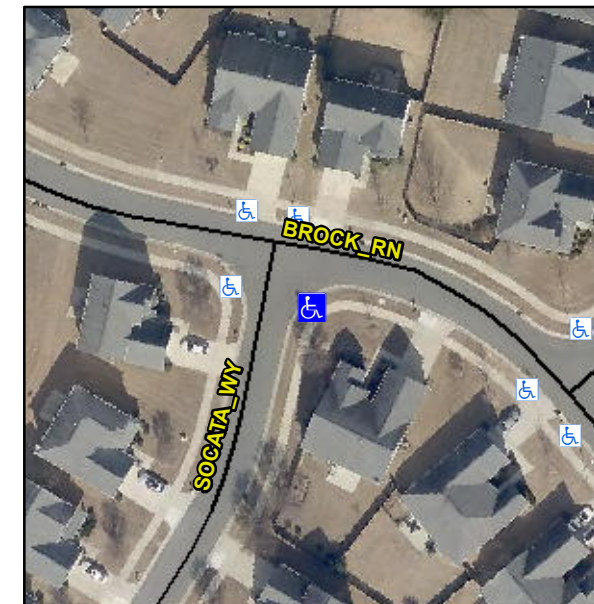

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

R304.5.1, R304.2.2-Perp, R304.3.2-Para, R304.5.4

Total Cost: \$ 3950.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	72.0	Yes	Ramp Slope (%)	7.2
No	Ramp Width (in)	46.0	Yes	Ramp XSlope (%)	0.5
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.1	Yes	Flare Slope RT (%)	2.6
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
Yes	Landing Length (in)	59.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	58.0	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	2.2	Yes	DWS Length (in)	25.5
Yes	Landing X Slope (%)	1.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.3
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.3
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.8		X Walk 2 Slope (%)	1.6
	X Walk 1 X Slope (%)	2.0		X Walk 2 X Slope (%)	2.6
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	0.2	N/A	Clear Space?	Yes
	Road X Slope (%)	3.3	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Street 1 Name **BROCK RN**
 Stop Condition-Street 2 **None**
 Street 2 Name **SOCATA WY**
 Stop Condition-Street 1 **StopSign**

