

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 5833	Main Street: GUM_BRANCH_RD	Cross Street: KENTBERRY_DR	Location: S
ADA ID: 34CEB7DE5573	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 15

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

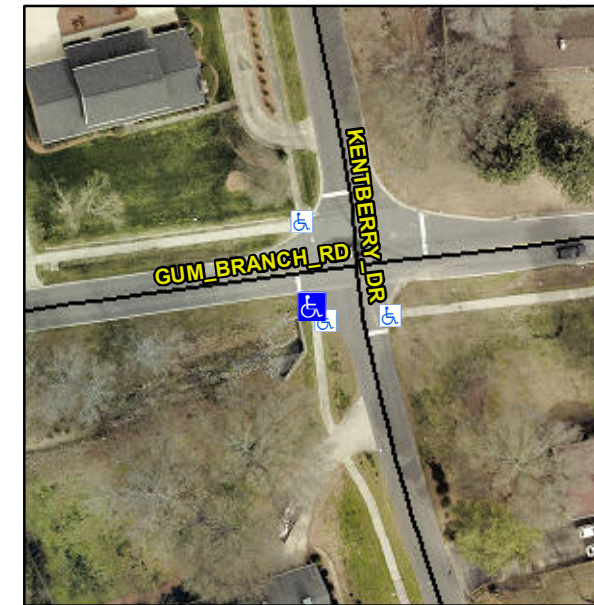

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**R304.5.3, R305.1.4, R305.2, R302.7,
R302.7.2, R304.5.4**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	87.0	Yes	Grade Break?	Yes
Yes	Ramp Width (in)	58.0	Yes	Grade Break Slope (%)	2.1
Yes	Ramp Slope (%)	0.6	No	Grade Break XSlope (%)	3.1
Yes	Ramp XSlope (%)	1.9			
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
Yes	Landing Length (in)	58.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	58.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.3	Yes	DWS Length (in)	24.5
Yes	Landing X Slope (%)	1.2	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	5.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	36.0
No	Gutter Ponding?	Yes	No	Gutter Slope (%)	8.6
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.3
N/A	Painted X Walk1?	No		Road Slope (%)	0.9
	X Walk 1 Direction	To N		Road X Slope (%)	0.2
	X Walk 1 Width (in)	N/A		Clear Space?	Yes
	X Walk 1 Slope (%)	0.9	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	0.2	Yes	Storm Grate/Utility Hazard?	No
N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	0.1

Total Cost: \$ 2350.00

