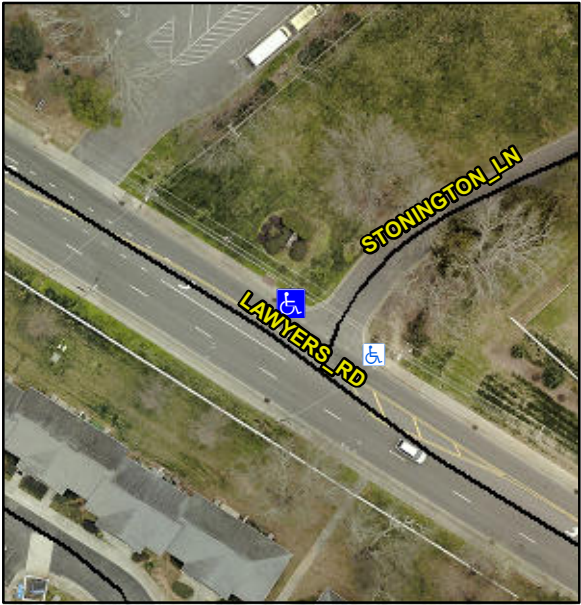


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: N/A	Main Street: STONINGTON_LN	Cross Street: LAWYERS_RD	Location: NW
ADA ID: 35E248C1C6B2	Ramp Type: Directional2	Initial Pass/Fail: Fail	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 25			

	Possible Solutions:						
	Remove & Replace Entire Ramp.						
	Surveyor Notes:  N/A	Compliance	Description	Data	Compliance	Description	Data
		N/A	Ramp Length (in)	81.0	N/A	Grade Break?	N/A
		Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0
		Yes	Ramp Slope (%)	8.2	N/A	Grade Break XSlope (%)	0.0
		No	Ramp XSlope (%)	12.0			
		N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
		N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0
		N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
		N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A
		N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A
	PROW/ADA:  R304.5.3	N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A
		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A
		N/A	Gutter Lip Ht (in)	1.5	N/A	Gutter X Slope (%)	N/A
		N/A	Painted X Walk1?	No		Road Slope (%)	1.3
			X Walk 1 Direction	To SE		Road X Slope (%)	0.7
			X Walk 1 Width (in)	N/A		Clear Space?	N/A
			X Walk 1 Slope (%)	1.3	N/A	Clear Space to XWalk (in)	N/A
			X Walk 1 X Slope (%)	0.7	N/A	Storm Grate/Utility Hazard?	N/A
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
		N/A	Any Obstructions?	N/A			N/A
			Obstruction Type		Yes	Surface Condition? (G/P)	Good
					N/A	Curb Slope (%)	0.3
	Total Cost:	\$	1800.00				

