

Access Compliance Report


Public Rights-of-Way

(Curb Ramps)

Intersection ID: 10039814	Main Street: TOM_SHORT_RD	Cross Street: N/A	Location: SW
ADA ID: 35F33664B3E8	Ramp Type: PerpDiag	Initial Pass/Fail: Pass	Overall Compliance: No
			Severity Score: 12.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

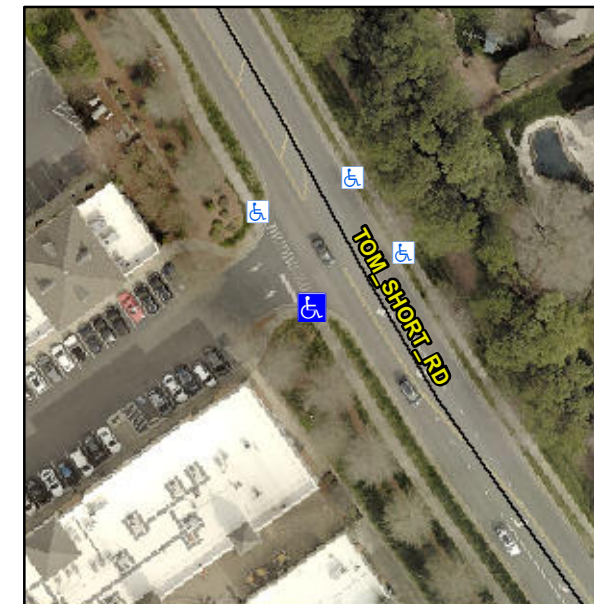

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R304.2.1, R304.2.2-Perp, R304.3.2-Para, R305.1.4, R305.2

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	64.0	Yes	Ramp Slope (%)	6.4
Yes	Ramp Width (in)	49.0	No	Ramp XSlope (%)	3.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	6.7	Yes	Flare Slope RT (%)	3.1
N/A	Flare Traversable LT?	Yes	N/A	Flare Traversable RT?	Yes
No	Landing Length (in)	N/A	Yes	DWS Provided?	Yes
No	Landing Width (in)	N/A	Yes	DWS Contrast?	Yes
No	Landing Slope (%)	N/A	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	N/A	No	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	3.0
N/A	Shared Landing?	N/A			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	1.0
Yes	Gutter Lip Ht (in)	0.0	No	Gutter X Slope (%)	2.9
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	Yes
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	61.0
	X Walk 1 Slope (%)	3.1		X Walk 2 Slope (%)	0.8
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	5.0
N/A	Ramp inside XWalk1?	N/A	Yes	Ramp inside XWalk2?	Yes
	Road Slope (%)	2.6	N/A	Clear Space?	Yes
	Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

Total Cost: \$ 3950.00

Street 1 Name	ENTRANCE
Stop Condition-Street 2	None
Street 2 Name	N/A
Stop Condition-Street 1	None

