


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 15133	Main Street: PERIMETER_POINTE_PY	Cross Street: W_TYVOLA_RD	Location: SE
ADA ID: 365F7BBEBAC0	Ramp Type: Para	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

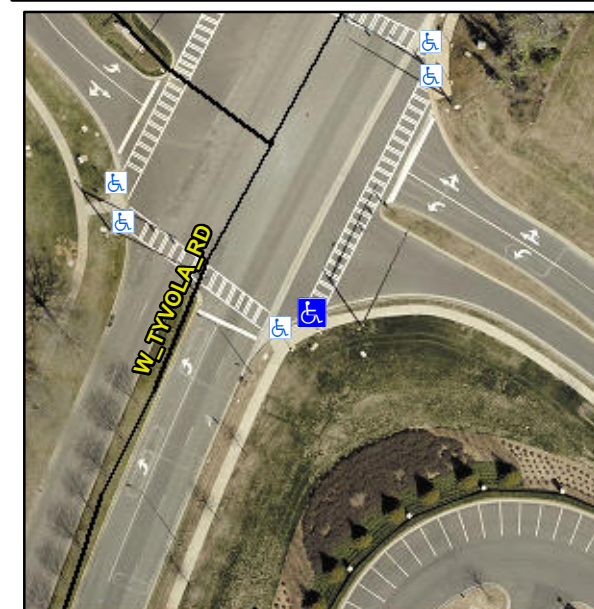

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

**Not Found, R304.2.1, R305.2,
R304.5.4**

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length LT (in)	72.0	N/A	Ramp Length RT (in)	72.0
Yes	Ramp Width LT (in)	69.5	Yes	Ramp Width RT (in)	70.5
Yes	Ramp Slope LT (%)	6.8	Yes	Ramp Slope RT (%)	5.8
Yes	Ramp XSlope LT (%)	0.8	Yes	Ramp XSlope RT (%)	1.7
Yes	Landing Length (in)	98.0	Yes	DWS Provided?	Yes
No	Landing Width (in)	47.5	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	1.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.2	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	5.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	6.7
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.9
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To NE		X Walk 2 Direction	N/A
N/A	X Walk 1 Width (in)	99.0	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	0.8		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.6		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	N/A	N/A	Clear Space?	Yes
	Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			Replace	Curb Slope (%)	9.6

