

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

9.0

2.2

N/A

Good

Cross Street: KINGS PARADE BV Intersection ID: 44786 Main Street: AYRSLEY TOWN BV Location: NE **Overall Compliance: No** ADA ID: 366D92B7C0F5 Ramp Type: Perp Initial Pass/Fail: Fail Severity Score: 13.75

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance Data

78.0

49.0

N/A

Yes

To S

111.0

3.2

1.7

Yes

N/A

No

No

N/A

Compliance Description

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

DWS Full Width?

DWS Offset (in)

Gutter Slope (%)

Gutter X Slope (%)

Painted X Walk2?

X Walk 2 Direction

X Walk 2 Width (in)


X Walk 2 Slope (%)

X Walk 2 X Slope (%)

Ramp inside XWalk2?

Clear Space?

Flare Traversable RT?

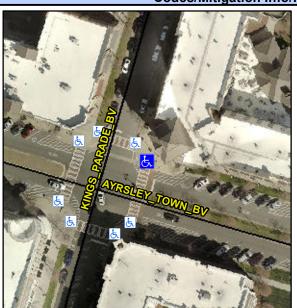

Street 1 Name	AYRSLEY TOWN BV
Stop Condition-Street 2	StopSign
Street 2 Name	N/A
Stop Condition-Street 1	N/A

r ossible Solution		i leiu ivie
Possible Solutions:	Compl	iance Description
Remove & Replace Entire Ramp.	N/A	Ramp Length (in)
	Yes	Ramp Width (in)
	N/A	Flare Type LT
	N/A	Flare Slope LT (%)
	N/A	Flare Traversable LT
	N/A	Landing Length (in)
Surveyor Notes:	N/A	Landing Width (in)
N/A	N/A	Landing Slope (%)
	N/A	Landing X Slope (%
	N/A	Landing Curb? (Y/N
	N/A	Shared Landing?
PROW/ADA:	N/A	Gutter Ponding?
R304.2.2, R304.5.3	N/A	Gutter Lip Ht (in)
	N/A	Painted X Walk1?
		X Walk 1 Direction
	N/A	X Walk 1 Width (in)
		X Walk 1 Slope (%)
		X Walk 1 X Slope (%

-		
1		



N/A

N/A Road X Slope (%) N/A Clear Space to XWalk (in) Any Obstructions? N/A N/A N/A Storm Grate/Utility Hazard? Total Cost: **Obstruction Type** Storm Grate/Utility Type 1850.00 N/A Yes Surface Condition? (G/P)

Road Slope (%)

X Walk 1 X Slope (%)

Ramp inside XWalk1?

Flare Traversable LT?

