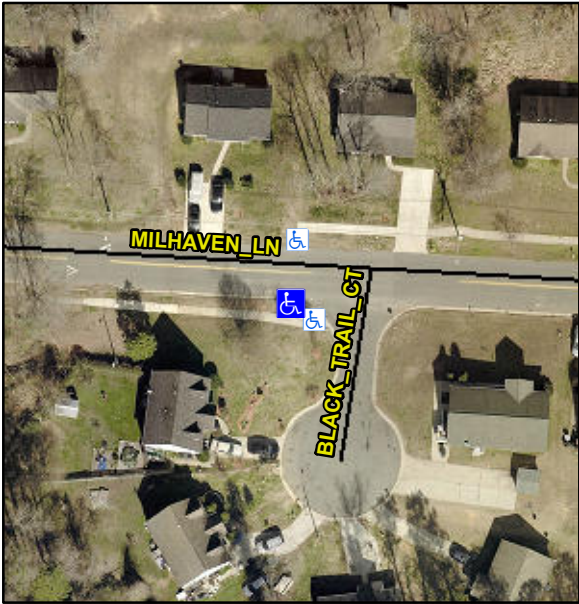


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 6358	Main Street: BLACK_TRAIL_CT	Cross Street: MILHAVEN_LN	Location: SW
ADA ID: 368D6FB8EE1C	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No
			Severity Score: 13.75

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	77.0	N/A	Grade Break?	N/A		
			Yes	Ramp Width (in)	57.0	N/A	Grade Break Slope (%)	0.0		
			No	Ramp Slope (%)	9.2	N/A	Grade Break XSlope (%)	0.0		
			No	Ramp XSlope (%)	2.3					
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A		
		N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A			
		N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A			
		N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A			
		N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A			
		N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A			
		N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A			
		N/A	Painted X Walk1?	No		Road Slope (%)	7.7			
			X Walk 1 Direction	To N		Road X Slope (%)	2.0			
			X Walk 1 Width (in)	N/A		Clear Space?	N/A			
			X Walk 1 Slope (%)	7.7	N/A	Clear Space to XWalk (in)	N/A			
			X Walk 1 X Slope (%)	2.0	N/A	Storm Grate/Utility Hazard?	N/A			
		N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type				
		N/A	Any Obstructions?	N/A			N/A			
			Obstruction Type		Yes	Surface Condition? (G/P)	Good			
					N/A	Curb Slope (%)	N/A			
Total Cost:		\$	1600.00							
Street 1 Name		MILHAVEN LN								
Stop Condition-Street 1		None								
Street 2 Name		N/A								
Stop Condition-Street 2		N/A								

Street 1 Name	MILHAVEN LN
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

