


# Access Compliance Report Public Rights-of-Way (Curb Ramps)

Intersection ID: 43656      Main Street: HUNTINGTON\_MEADOW\_LN      Cross Street: CALLOW\_FOREST\_DR      Location: NW

ADA ID: 36A52E57A968      Ramp Type: PerpDiag      Initial Pass/Fail: Pass      Overall Compliance: No      Severity Score: 15

**Codes/Mitigation Info/Possible Solution**      **Field Measurements/Component Compliance**

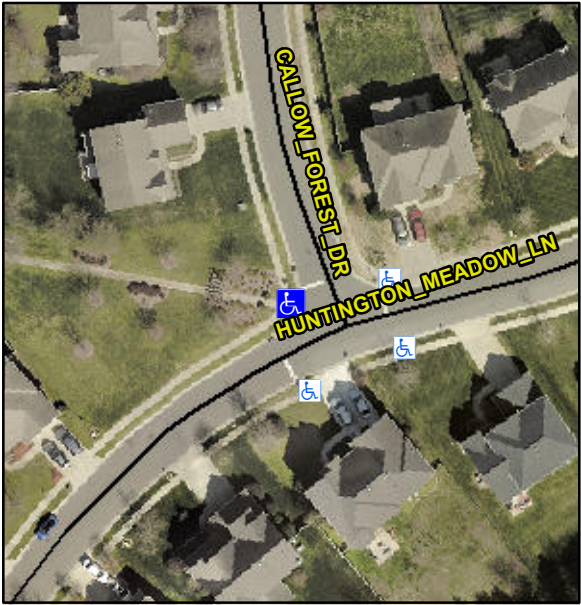

Possible Solutions:  
**Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent. Remove & Replace Gutter.**

Surveyor Notes:  
**N/A**

PROW/ADA:  
**Not Found, R304.2.2-Perp, R304.3.2-Para, R305, R304.5.4**

Street 1 Name      **HUNTINGTON MEADOW LN**  
 Stop Condition-Street 2      **StopSign**  
 Street 2 Name      **CALLOW FOREST DR**  
 Stop Condition-Street 1      **StopSign**

Total Cost:      \$      **3950.00**

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	48.0	Yes	Ramp Slope (%)	6.9
Yes	Ramp Width (in)	49.0	Yes	Ramp XSlope (%)	1.0
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	1.5	N/A	Flare Slope RT (%)	6.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	49.0	No	DWS Provided?	No
Yes	Landing Width (in)	48.0	N/A	DWS Contrast?	No
No	Landing Slope (%)	2.3	N/A	DWS Length (in)	N/A
Yes	Landing X Slope (%)	1.6	N/A	DWS Full Width?	No
N/A	Landing Curb? (Y/N)	No	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	No	Gutter Slope (%)	5.6
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.7
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To S		X Walk 2 Direction	To E
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	2.4		X Walk 2 Slope (%)	3.4
	X Walk 1 X Slope (%)	3.0		X Walk 2 X Slope (%)	1.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	2.0	N/A	Clear Space?	Yes
	Road X Slope (%)	6.6	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
			N/A		N/A
			Yes	Surface Condition? (G/P)	Good

