

# Access Compliance Report


## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 51615	Main Street: BENFIELD_RD	Cross Street: PROSPERITY_CHURCH_RD	Location: NW
ADA ID: 36E763DF6307	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0.25	

#### Codes/Mitigation Info/Possible Solution

#### Field Measurements/Component Compliance

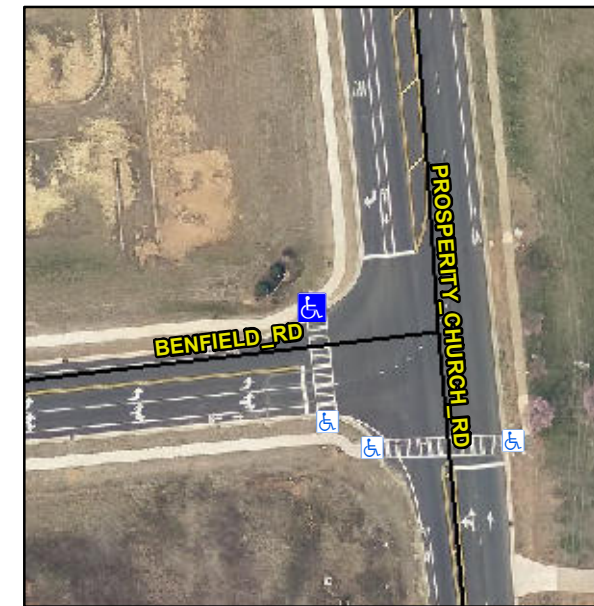

Possible Solutions:

**Remove & Replace Curb Slope and Extend Ramp.**

Surveyor Notes:

**N/A**

PROW/ADA:

**Not Found**

Total Cost: \$ 2000.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	26.0	Yes	BlendTrans Slope (%)	2.6
Yes	Ramp Width (in)	48.0	Yes	BlendTrans XSlope (%)	2.1
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.3	N/A	Flare Slope RT (%)	7.9
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	70.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	48.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	2.0	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	1.7	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	Yes	DWS Offset (in)	1.0
N/A	Shared Landing?	No			
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.5
Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	1.8
N/A	Painted X Walk1?	Yes	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To S		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	112.0		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	4.1		X Walk 2 X Slope (%)	N/A
Yes	Ramp inside XWalk1?	Yes	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	4.1		Clear Space?	Yes
	Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	10.8

Street 1 Name	BENFIELD RD
Stop Condition-Street 1	Signal
Street 2 Name	N/A
Stop Condition-Street 2	N/A

