


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 53380	Main Street: IKEA_BV	Cross Street: LEWIS_ST	Location: S
ADA ID: 36FBF3C8874F	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	
Severity Score: 7.5			

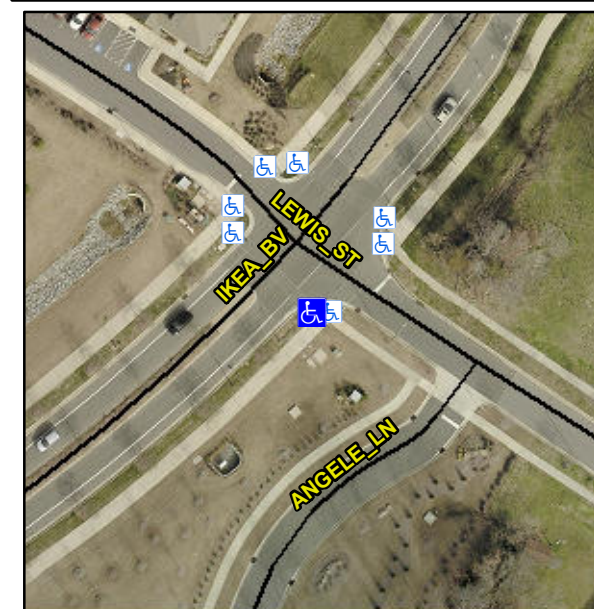

Possible Solutions:

**Remove & Replace Entire Ramp.
Remove & Replace Gutter.**

Surveyor Notes:

N/A

PROW/ADA:

R304.5.2, R302.7.2, R304.5.3

Total Cost: \$ 2350.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	41.0	No	Grade Break?	No
Yes	Ramp Width (in)	73.0	N/A	Grade Break Slope (%)	N/A
Yes	Ramp Slope (%)	7.6	N/A	Grade Break XSlope (%)	N/A
Yes	Ramp XSlope (%)	0.2			
Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	95.0	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	87.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.6	Yes	DWS Length (in)	24.0
Yes	Landing X Slope (%)	0.3	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	N/A	Yes	DWS Offset LT (in)	0.0
N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	0.0
Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	0.5
No	Gutter Lip Ht (in)	0.3	No	Gutter X Slope (%)	5.7
N/A	Painted X Walk1?	Yes		Road Slope (%)	2.5
	X Walk 1 Direction	To NW		Road X Slope (%)	4.4
	X Walk 1 Width (in)	58.0		Clear Space?	Yes
	X Walk 1 Slope (%)	2.5	N/A	Clear Space to XWalk (in)	N/A
	X Walk 1 X Slope (%)	4.4	Yes	Storm Grate/Utility Hazard?	No
Yes	Ramp inside XWalk1?	Yes		Storm Grate/Utility Type	
Yes	Any Obstructions?	No			N/A
	Obstruction Type		Yes	Surface Condition? (G/P)	Good
			N/A	Curb Slope (%)	N/A

Street 1 Name: IKEA BV
 Stop Condition-Street 1: None
 Street 2 Name: N/A
 Stop Condition-Street 2: N/A

