


## **Access Compliance Report Public Rights-of-Way** (Curb Ramps)



Intersection ID: 20942 Main Street: CORONATION BV **Cross Street: CROWN CENTRE DR** Location: NE ADA ID: 373640690141 Ramp Type: PerpDiag Initial Pass/Fail: Fail **Overall Compliance: No Severity Score:** 25

**Codes/Mitigation Info/Possible Solution** 

## Field Measurements/Component Compliance

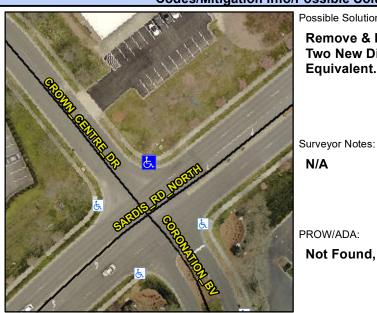

Street 1 Name Stop Condition-Street 2 Street 2 Name Stop Condition-Street 1 **CROWN CENTRE DR** StopSign **SARDIS RD NORTH** None

Possible Solutions: Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

N/A

PROW/ADA:

Not Found, R304.2.2, R304.5.3

Total Cost: 3200.00

Compliance Description Data		Comp	iance Desc	ription	Data	
N/A	Ramp Length (in)	68.0	No	Ramp Slope	∈ (%)	8.4
Yes	Ramp Width (in)	48.0	No	Ramp XSIo	pe (%)	6.4
N/A	Flare Type LT	N/A	N/A	Flare Type RT		N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)		N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?		N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provid	ded?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contr	ast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Lengt	h (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full V	/idth?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset	t (in)	N/A
N/A	Shared Landing?	N/A				
N/A	Gutter Ponding?	N/A	N/A	Gutter Slop	e (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slo	ope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X V	Valk2?	No
	X Walk 1 Direction	To SW		X Walk 2 Di	rection	To SE
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 W	idth (in)	N/A
	X Walk 1 Slope (%)	6.4		X Walk 2 SI	ope (%)	1.7
	X Walk 1 X Slope (%)	5.7		X Walk 2 X	Slope (%)	5.4
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp insid	e XWalk2?	N/A
	Road Slope (%)	3.3	N/A	Clear Space	e?	N/A
	Road X Slope (%)	4.8	N/A	Clear Space	e to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate	e/Utility Hazard?	N/A
	Obstruction Type		l	Storm Grate	e/Utility Type	
		N/A				N/A
			Yes	Surface Co	ndition? (G/P)	Good





