

Access Compliance Report Public Rights-of-Way (Curb Ramps)



Data

72.0

60.0

17.3

2.6

6.9

5.2

N/A

N/A

N/A

N/A

N/A

N/A

Main Street: HARDING PL Cross Street: N/A Location: W Intersection ID: 10027950 Initial Pass/Fail: Fail **Overall Compliance: No** ADA ID: 374FB63353C4 Ramp Type: Combination1 **Severity Score:** 37.5

Codes/Mitigation Info/Possible Solution

Field Measurements/Component Compliance

N/A

Yes

No

No

Yes

No

N/A

N/A

N/A

N/A

N/A

N/A N/A

Compliance Description

Ramp Length RT (in)

Ramp Width RT (in)

Ramp Slope RT (%)

Ramp Slope (%)

Flare Type RT

Ramp XSlope (%)

Flare Slope RT (%)

DWS Provided?

DWS Contrast?

DWS Length (in)

Flare Traversable RT?

Ramp XSlope RT (%)

Data

72.0

72.0

7.5

1.1

118.0

48.0

N/A

N/A


N/A

N/A

N/A

Flare Traversable LT?

Ramp XSlope LT (%)

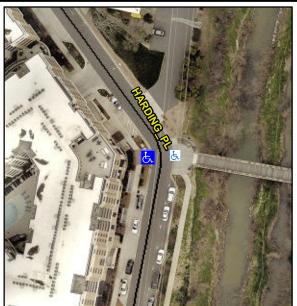

Street 1 Name None **HARDING PL** Stop Condition-Street 1 Street 2 Name N/A Stop Condition-Street 2 N/A

n ossible solution		i ieiu ivie
Possible Solutions:	Compli	ance Description
Remove & Replace Entire Ramp.	N/A	Ramp Length LT (in)
·	Yes	Ramp Width LT (in)
	Yes	Ramp Slope LT (%)
	Yes	Ramp XSlope LT (%
	N/A	Ramp Length (in)
	Yes	Ramp Width (in)
Surveyor Notes:	N/A	Flare Type LT
N/A	N/A	Flare Slope LT (%)
	N/A	Flare Traversable LT
	N/A	Landing Length (in)
	N/A	Landing Width (in)
PROW/ADA:	N/A	Landing Slope (%)
Not Found, R304.5.3, R304.3.2	N/A	Landing X Slope (%
	N/A	Landing Curb? (Y/N
	N/A	Shared Landing?
	N/A	Gutter Ponding?
	N/A	Gutter Lip Ht (in)
	N/A	Painted X Walk1?
		X Walk 1 Direction
		X Walk 1 Width (in)
		X Walk 1 Slope (%)



Total Cost:



1800.00

Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
Shared Landing?	N/A			
Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
X Walk 1 Direction	То Е		X Walk 2 Direction	N/A
X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
X Walk 1 Slope (%)	2.2		X Walk 2 Slope (%)	N/A
X Walk 1 X Slope (%)	6.8		X Walk 2 X Slope (%)	N/A
Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
Road Slope (%)	N/A		Clear Space?	N/A
Road X Slope (%)	N/A	N/A	Clear Space to XWalk (in)	N/A
		N/A	Any Obstruction?	N/A
			Obstruction Type	
				N/A
		N/A	Storm Grate/Utility Hazard?	N/A
			Storm Grate/Utility Type	
				N/A
		Yes	Surface Condition? (G/P)	Good
			Curb Slope (%)	10.1
	Landing Curb? (Y/N) Shared Landing? Gutter Ponding? Gutter Lip Ht (in) Painted X Walk1? X Walk 1 Direction X Walk 1 Width (in) X Walk 1 Slope (%) X Walk 1 X Slope (%) Ramp inside XWalk1? Road Slope (%)	Landing Curb? (Y/N) Shared Landing? N/A Gutter Ponding? N/A Gutter Lip Ht (in) Painted X Walk1? X Walk 1 Direction X Walk 1 Width (in) X Walk 1 Slope (%) X Walk 1 X Slope (%) Ramp inside XWalk1? N/A Road Slope (%) N/A	Landing Curb? (Y/N) Shared Landing? Rutter Ponding? N/A Gutter Lip Ht (in) Painted X Walk1? X Walk 1 Direction X Walk 1 Slope (%) X Walk 1 X Slope (%) Ramp inside XWalk1? Road Slope (%) Road X Slope (%) N/A N/A N/A N/A N/A N/A N/A	Landing Curb? (Y/N) Shared Landing? Gutter Ponding? Gutter Lip Ht (in) Painted X Walk1? X Walk 1 Direction X Walk 1 Slope (%) Ramp inside XWalk1? Road Slope (%) Road X Slope (%) Road X Slope (%) N/A Road X Slope (%) N/A Road Stope (%) N/A Road Stope (%) N/A Road X Storm Grate/Utility Hazard? Storm Grate/Utility Type Yes Surface Condition? (G/P)

