


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 4278		Main Street: LAKEWOOD_EDGE_DR	Cross Street: WYLIE_MEADOW_LN	Location:	SE
ADA ID: 37652F1D409F		Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 28.75
Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance		
		Possible Solutions:	Compliance	Description	Data
		Remove & Replace Entire Ramp.	N/A	Ramp Length (in)	40.0
<p>Surveyor Notes:</p> <p>N/A</p> <p>PROW/ADA:</p> <p>R304.2.2, R304.5.3, R302.7</p>			Yes	Ramp Width (in)	48.0
			No	Ramp Slope (%)	11.5
			No	Ramp XSlope (%)	3.5
			N/A	Flare Type LT	N/A
			N/A	Flare Slope LT (%)	N/A
			N/A	Flare Traversable LT?	N/A
			N/A	Landing Length (in)	0.0
			N/A	Landing Width (in)	0.0
			N/A	Landing Slope (%)	0.0
			N/A	Landing X Slope (%)	0.0
			N/A	Landing Curb? (Y/N)	N/A
			N/A	Shared Landing?	N/A
			N/A	Gutter Ponding?	0.0
			N/A	Gutter Lip Ht (in)	0.0
			N/A	Painted X Walk1?	No
				X Walk 1 Direction	To N
				X Walk 1 Width (in)	N/A
				X Walk 1 Slope (%)	4.0
				X Walk 1 X Slope (%)	2.6
			N/A	Ramp inside XWalk1?	N/A
			N/A	Any Obstructions?	N/A
				Obstruction Type	No
			N/A	Surface Condition? (G/P)	Poor
			N/A	Curb Slope (%)	N/A
<p>Street 1 Name</p> <p>Stop Condition-Street 1</p> <p>Street 2 Name</p> <p>Stop Condition-Street 2</p>		<p>WYLIE MEADOWS LN</p> <p>None</p> <p>N/A</p> <p>N/A</p>	<p>Total Cost: \$ 1600.00</p>		

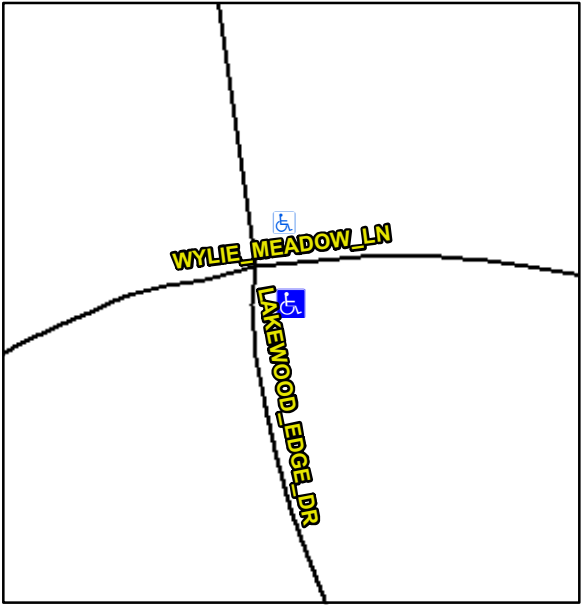