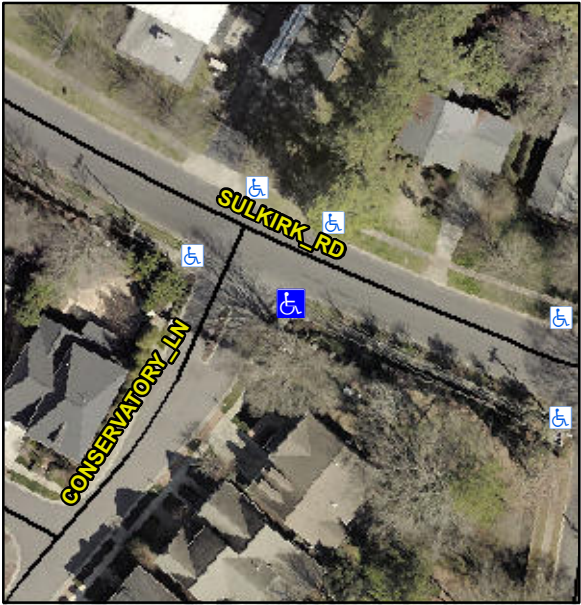


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 49356	Main Street: CONSERVATORY_LN	Cross Street: SULKIRK_RD	Location: S
ADA ID: 379BA69B7AA1	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 25	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
	Possible Solutions:	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>			
	Surveyor Notes:	N/A			
	PROW/ADA:	Not Found, R304.5.3			
	Street 1 Name	SULKIRK RD			
	Stop Condition-Street 2	None			
	Street 2 Name	CONSERVATORY LN			
	Stop Condition-Street 1	StopSign			
	Total Cost:	\$ 3200.00			

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	114.0	Yes	Ramp Slope (%)	7.3
Yes	Ramp Width (in)	48.0	No	Ramp XSlope (%)	7.7
N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A
N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A
N/A	Landing Length (in)	N/A	N/A	DWS Provided?	N/A
N/A	Landing Width (in)	N/A	N/A	DWS Contrast?	N/A
N/A	Landing Slope (%)	N/A	N/A	DWS Length (in)	N/A
N/A	Landing X Slope (%)	N/A	N/A	DWS Full Width?	N/A
N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset (in)	N/A
N/A	Shared Landing?	N/A			
N/A	Gutter Ponding?	N/A	N/A	Gutter Slope (%)	N/A
N/A	Gutter Lip Ht (in)	N/A	N/A	Gutter X Slope (%)	N/A
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	No
	X Walk 1 Direction	To NE		X Walk 2 Direction	To NW
N/A	X Walk 1 Width (in)	N/A	N/A	X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	6.8		X Walk 2 Slope (%)	0.3
	X Walk 1 X Slope (%)	0.7		X Walk 2 X Slope (%)	6.8
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	6.4	N/A	Clear Space?	N/A
	Road X Slope (%)	4.7	N/A	Clear Space to XWalk (in)	N/A
N/A	Any Obstructions?	N/A	N/A	Storm Grate/Utility Hazard?	N/A
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good

