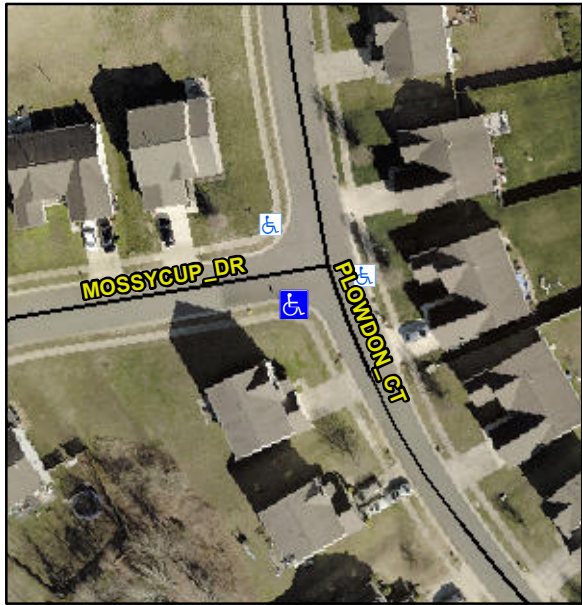


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 31717	Main Street: MOSSYCUP_DR	Cross Street: PLOWDON_CT	Location: SW
ADA ID: 37E9895A2FFC	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
Severity Score: 37.5			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

	Possible Solutions:							
	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>							
	Surveyor Notes:							
	<b>N/A</b>							
	PROW/ADA:							
	<b>Not Found, R304.2.2, R304.5.3</b>							
	Street 1 Name	<b>PLOWDON CT</b>	Compliance	Description	Data	Compliance	Description	Data
	Stop Condition-Street 2	<b>None</b>	<b>N/A</b>	Ramp Length (in)	<b>47.0</b>	<b>No</b>	Ramp Slope (%)	<b>10.6</b>
	Street 2 Name	<b>MOSSYCUP DR</b>	<b>Yes</b>	Ramp Width (in)	<b>48.0</b>	<b>No</b>	Ramp XSlope (%)	<b>8.1</b>
	Stop Condition-Street 1	<b>StopSign</b>	<b>N/A</b>	Flare Type LT	<b>N/A</b>	<b>N/A</b>	Flare Type RT	<b>N/A</b>
		<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>	<b>N/A</b>	Flare Slope RT (%)	<b>N/A</b>	
		<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>	<b>N/A</b>	Flare Traversable RT?	<b>N/A</b>	
		<b>N/A</b>	Landing Length (in)	<b>N/A</b>	<b>N/A</b>	DWS Provided?	<b>N/A</b>	
		<b>N/A</b>	Landing Width (in)	<b>N/A</b>	<b>N/A</b>	DWS Contrast?	<b>N/A</b>	
		<b>N/A</b>	Landing Slope (%)	<b>N/A</b>	<b>N/A</b>	DWS Length (in)	<b>N/A</b>	
		<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>	<b>N/A</b>	DWS Full Width?	<b>N/A</b>	
		<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>	<b>N/A</b>	DWS Offset (in)	<b>N/A</b>	
		<b>N/A</b>	Shared Landing?	<b>N/A</b>				
		<b>N/A</b>	Gutter Ponding?	<b>N/A</b>	<b>N/A</b>	Gutter Slope (%)	<b>N/A</b>	
		<b>N/A</b>	Gutter Lip Ht (in)	<b>N/A</b>	<b>N/A</b>	Gutter X Slope (%)	<b>N/A</b>	
		<b>N/A</b>	Painted X Walk1?	<b>No</b>	<b>N/A</b>	Painted X Walk2?	<b>No</b>	
			X Walk 1 Direction	<b>To E</b>		X Walk 2 Direction	<b>To N</b>	
		<b>N/A</b>	X Walk 1 Width (in)	<b>N/A</b>	<b>N/A</b>	X Walk 2 Width (in)	<b>N/A</b>	
			X Walk 1 Slope (%)	<b>5.3</b>		X Walk 2 Slope (%)	<b>0.1</b>	
			X Walk 1 X Slope (%)	<b>5.9</b>		X Walk 2 X Slope (%)	<b>6.8</b>	
		<b>N/A</b>	Ramp inside XWalk1?	<b>N/A</b>	<b>N/A</b>	Ramp inside XWalk2?	<b>N/A</b>	
			Road Slope (%)	<b>7.7</b>	<b>N/A</b>	Clear Space?	<b>N/A</b>	
			Road X Slope (%)	<b>1.2</b>	<b>N/A</b>	Clear Space to XWalk (in)	<b>N/A</b>	
		<b>N/A</b>	Any Obstructions?	<b>N/A</b>	<b>N/A</b>	Storm Grate/Utility Hazard?	<b>N/A</b>	
			Obstruction Type			Storm Grate/Utility Type		
				<b>N/A</b>			<b>N/A</b>	
					<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>	
Total Cost:		<b>\$</b>	<b>3200.00</b>					

