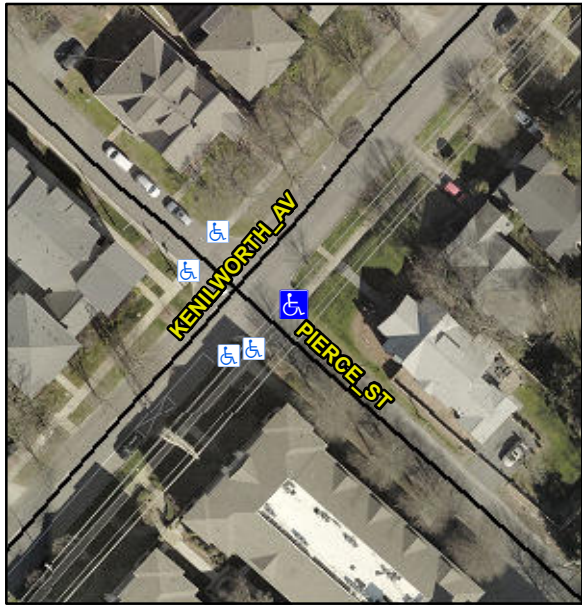


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 14918	Main Street: KENILWORTH_AV	Cross Street: PIERCE_ST	Location:	E
ADA ID: 37FC78EE94DA	Ramp Type: Directional1	Initial Pass/Fail: Fail	Overall Compliance: No	Severity Score: 1.25

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance							
	Possible Solutions:		Compliance			Description			Data	
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	26.0	N/A	Grade Break?	N/A		
			Yes	Ramp Width (in)	48.0	N/A	Grade Break Slope (%)	0.0		
			Yes	Ramp Slope (%)	0.3	N/A	Grade Break XSlope (%)	0.0		
			No	Ramp XSlope (%)	4.3					
			N/A	Flare Type LT	N/A	N/A	Flare Type RT	N/A		
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	0.0		
			N/A	Flare Traversable LT?	N/A	N/A	Flare Traversable RT?	N/A		
			N/A	Landing Length (in)	0.0	N/A	DWS Provided?	N/A		
			N/A	Landing Width (in)	0.0	N/A	DWS Contrast?	N/A		
Surveyor Notes:		N/A	N/A	Landing Slope (%)	0.0	N/A	DWS Length (in)	N/A		
		N/A	N/A	Landing X Slope (%)	0.0	N/A	DWS Full Width?	N/A		
PROW/ADA:		R304.5.3	N/A	Landing Curb? (Y/N)	N/A	N/A	DWS Offset LT (in)	N/A		
			N/A	Shared Landing?	N/A	N/A	DWS Offset RT (in)	N/A		
			N/A	Gutter Ponding?	0.0	N/A	Gutter Slope (%)	N/A		
			N/A	Gutter Lip Ht (in)	0.0	N/A	Gutter X Slope (%)	N/A		
			N/A	Painted X Walk1?	No		Road Slope (%)	5.4		
				X Walk 1 Direction	To SW		Road X Slope (%)	1.5		
				X Walk 1 Width (in)	N/A		Clear Space?	N/A		
				X Walk 1 Slope (%)	5.4	N/A	Clear Space to XWalk (in)	N/A		
				X Walk 1 X Slope (%)	1.5	N/A	Storm Grate/Utility Hazard?	N/A		
			N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type			
			N/A	Any Obstructions?	N/A			N/A		
				Obstruction Type		Yes	Surface Condition? (G/P)	Good		
						N/A	Curb Slope (%)	8.5		
Street 1 Name		PIERCE ST								
Stop Condition-Street 1		StopSign								
Street 2 Name		N/A								
Stop Condition-Street 2		N/A								
Total Cost:			\$	1600.00						

