


Access Compliance Report

Public Rights-of-Way

(Curb Ramps)

Intersection ID: 8285	Main Street: CATHERINE_SIMMONS_AV	Cross Street: HAINES_ST	Location: SE
ADA ID: 38979A17B4A3	Ramp Type: BlendTrans1	Initial Pass/Fail: Pass	Overall Compliance: No
Severity Score: 7.75			
Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance	

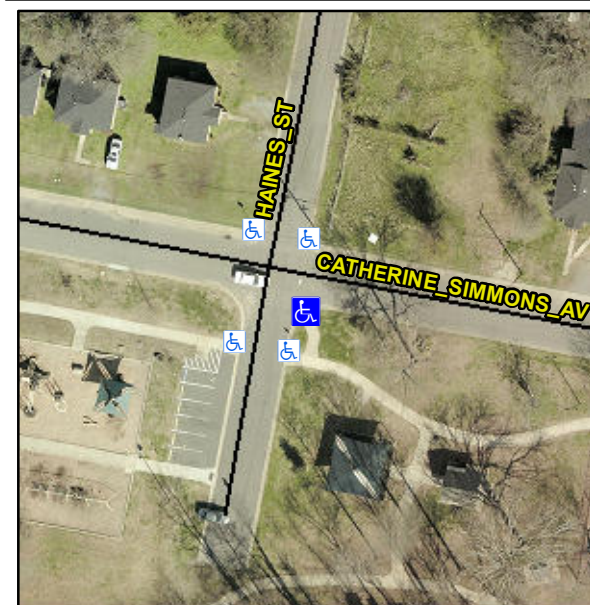

Possible Solutions:

Remove & Replace Curb Ramp With Two New Directional Ramps or Equivalent.

Surveyor Notes:

N/A

PROW/ADA:

Not Found, R304.5.3, R305.2, R302.7, R302.7.2

Street 1 Name	CATHERINE SIMMONS AV
Stop Condition-Street 1	None
Street 2 Name	N/A
Stop Condition-Street 2	N/A

Total Cost: \$ 3200.00

Compliance	Description	Data	Compliance	Description	Data
N/A	Ramp Length (in)	71.5	Yes	BlendTrans Slope (%)	2.5
Yes	Ramp Width (in)	71.5	No	BlendTrans XSlope (%)	2.7
N/A	Flare Type LT	Sloped	N/A	Flare Type RT	Sloped
N/A	Flare Slope LT (%)	3.4	N/A	Flare Slope RT (%)	0.4
N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
Yes	Landing Length (in)	59.5	Yes	DWS Provided?	Yes
Yes	Landing Width (in)	73.0	Yes	DWS Contrast?	Yes
Yes	Landing Slope (%)	0.7	Yes	DWS Length (in)	24.0
No	Landing X Slope (%)	2.9	Yes	DWS Full Width?	Yes
N/A	Landing Curb? (Y/N)	No	No	DWS Offset (in)	4.5
N/A	Shared Landing?	No			
No	Gutter Ponding?	Yes	Yes	Gutter Slope (%)	3.5
No	Gutter Lip Ht (in)	0.5	Yes	Gutter X Slope (%)	0.5
N/A	Painted X Walk1?	No	N/A	Painted X Walk2?	N/A
	X Walk 1 Direction	To N		X Walk 2 Direction	N/A
	X Walk 1 Width (in)	N/A		X Walk 2 Width (in)	N/A
	X Walk 1 Slope (%)	3.4		X Walk 2 Slope (%)	N/A
	X Walk 1 X Slope (%)	1.8		X Walk 2 X Slope (%)	N/A
N/A	Ramp inside XWalk1?	N/A	N/A	Ramp inside XWalk2?	N/A
	Road Slope (%)	1.8		Clear Space?	Yes
	Road X Slope (%)	3.4	N/A	Clear Space to XWalk (in)	N/A
Yes	Any Obstructions?	No	Yes	Storm Grate/Utility Hazard?	No
	Obstruction Type			Storm Grate/Utility Type	
		N/A			N/A
			Yes	Surface Condition? (G/P)	Good
			No	Curb Slope (%)	6.0

