


Access Compliance Report

Public Rights-of-Way (Curb Ramps)

Intersection ID: 17494	Main Street: MONROE_RD	Cross Street: FOREST_WAY_DR	Location: SE
ADA ID: 38BBAB38B533	Ramp Type: Directional1	Initial Pass/Fail: Pass	Overall Compliance: No
		Severity Score: 0	

Codes/Mitigation Info/Possible Solution			Field Measurements/Component Compliance					
	Possible Solutions:		Compliance	Description	Data	Compliance	Description	Data
	Remove & Replace Entire Ramp.		N/A	Ramp Length (in)	77.0	Yes	Grade Break?	Yes
			Yes	Ramp Width (in)	73.0	Yes	Grade Break Slope (%)	0.2
			Yes	Ramp Slope (%)	2.9	Yes	Grade Break XSlope (%)	1.0
			Yes	Ramp XSlope (%)	1.0			
			Yes	Flare Type LT	N/A	Yes	Flare Type RT	N/A
			N/A	Flare Slope LT (%)	N/A	N/A	Flare Slope RT (%)	N/A
			N/A	Flare Traversable LT?	No	N/A	Flare Traversable RT?	No
			Yes	Landing Length (in)	84.5	Yes	DWS Provided?	Yes
			Yes	Landing Width (in)	73.0	Yes	DWS Contrast?	Yes
Surveyor Notes:			No	Landing Slope (%)	2.5	Yes	DWS Length (in)	24.0
N/A			Yes	Landing X Slope (%)	1.4	Yes	DWS Full Width?	Yes
PROW/ADA:			N/A	Landing Curb? (Y/N)	No	No	DWS Offset LT (in)	5.0
R304.2.2-Perp, R304.3.2-Para, R305.2			N/A	Shared Landing?	Yes	Yes	DWS Offset RT (in)	15.0
			Yes	Gutter Ponding?	No	Yes	Gutter Slope (%)	2.8
			Yes	Gutter Lip Ht (in)	0.0	Yes	Gutter X Slope (%)	0.8
			N/A	Painted X Walk1?	No		Road Slope (%)	1.3
				X Walk 1 Direction	To SW		Road X Slope (%)	0.2
				X Walk 1 Width (in)	N/A		Clear Space?	Yes
				X Walk 1 Slope (%)	1.3	N/A	Clear Space to XWalk (in)	N/A
				X Walk 1 X Slope (%)	0.2	Yes	Storm Grate/Utility Hazard?	No
			N/A	Ramp inside XWalk1?	N/A		Storm Grate/Utility Type	
			Yes	Any Obstructions?	No			N/A
				Obstruction Type		Yes	Surface Condition? (G/P)	Good
						N/A	Curb Slope (%)	3.5
Street 1 Name		MONROE RD						
Stop Condition-Street 1		None						
Street 2 Name		N/A						
Stop Condition-Street 2		N/A						
Total Cost:		\$ 1600.00						

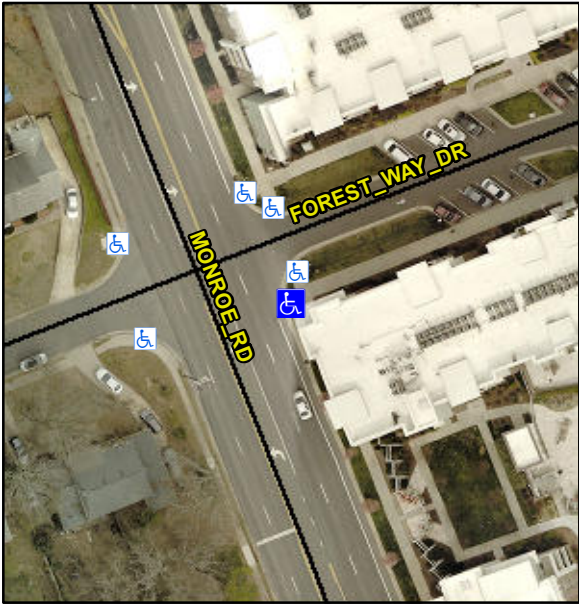