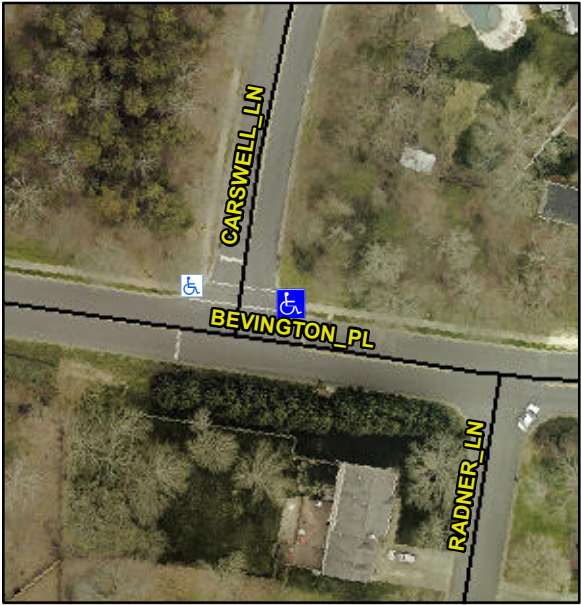


# Access Compliance Report

## Public Rights-of-Way

### (Curb Ramps)

Intersection ID: 26420	Main Street: BEVINGTON_PL	Cross Street: CARSWELL_LN	Location: NE
ADA ID: 3931A7FC863A	Ramp Type: PerpDiag	Initial Pass/Fail: Fail	Overall Compliance: No
		Severity Score: 12.5	

Codes/Mitigation Info/Possible Solution		Field Measurements/Component Compliance			
 <p>Street 1 Name                      <b>CARSWELL LN</b></p> <p>Stop Condition-Street 2            <b>StopSign</b></p> <p>Street 2 Name                      <b>BEVINGTON PL</b></p> <p>Stop Condition-Street 1            <b>StopSign</b></p>	Possible Solutions:	<b>Remove &amp; Replace Curb Ramp With Two New Directional Ramps or Equivalent.</b>			
	Surveyor Notes:	<b>N/A</b>			
	PROW/ADA:	<b>Not Found, R304.2.2</b>			
	Total Cost:	<b>\$ 3200.00</b>			
			<b>Compliance</b>	<b>Description</b>	<b>Data</b>
			<b>No</b>	Ramp Length (in)	<b>58.0</b>
			<b>Yes</b>	Ramp Width (in)	<b>48.0</b>
			<b>N/A</b>	Flare Type LT	<b>N/A</b>
			<b>N/A</b>	Flare Slope LT (%)	<b>N/A</b>
			<b>N/A</b>	Flare Traversable LT?	<b>N/A</b>
			<b>N/A</b>	Landing Length (in)	<b>N/A</b>
			<b>N/A</b>	Landing Width (in)	<b>N/A</b>
			<b>N/A</b>	Landing Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Landing Curb? (Y/N)	<b>N/A</b>
			<b>N/A</b>	Shared Landing?	<b>N/A</b>
			<b>N/A</b>	Gutter Ponding?	<b>N/A</b>
			<b>N/A</b>	Gutter Lip Ht (in)	<b>N/A</b>
			<b>N/A</b>	Painted X Walk1?	<b>Yes</b>
			<b>To NW</b>	X Walk 1 Direction	<b>To SW</b>
			<b>N/A</b>	X Walk 1 Width (in)	<b>111.0</b>
			<b>1.9</b>	X Walk 1 Slope (%)	<b>N/A</b>
			<b>1.5</b>	X Walk 1 X Slope (%)	<b>1.6</b>
			<b>N/A</b>	Ramp inside XWalk1?	<b>0.1</b>
			<b>Yes</b>	Ramp inside XWalk2?	<b>N/A</b>
			<b>0.8</b>	Road Slope (%)	<b>N/A</b>
			<b>2.8</b>	Road X Slope (%)	<b>N/A</b>
			<b>N/A</b>	Any Obstructions?	<b>N/A</b>
			<b>N/A</b>	Obstruction Type	<b>N/A</b>
			<b>N/A</b>	Clear Space?	<b>N/A</b>
			<b>N/A</b>	Clear Space to XWalk (in)	<b>N/A</b>
			<b>N/A</b>	Storm Grate/Utility Hazard?	<b>N/A</b>
			<b>N/A</b>	Storm Grate/Utility Type	<b>N/A</b>
			<b>Yes</b>	Surface Condition? (G/P)	<b>Good</b>

